



Publication Year	2005
Acceptance in OA	2024-03-07T10:33:24Z
Title	ECCOSORB Failure Analysis
Authors	Brighenti, Alberto, CUTTAIA, FRANCESCO, DE ROSA, Adriano Giuseppe, Orsi, Giordano, TERENZI, LUCA, VALENZIANO, Luca
Handle	http://hdl.handle.net/20.500.12386/34918
Volume	PL-LFI-TES-TN-015

TITLE: ECCOSORB failure analysis

DOC. TYPE: TECHNICAL NOTE

PROJECT REF.: PL-LFI-TES-TN-015

PAGE: I of V, 45

ISSUE/REV.: 1.0

DATE: May 2005

Prepared by	A. BRIGHENTI F. CUTTAIA A. DE ROSA G. ORSI L. TERENCE L. VALENZIANO LFI 4K RL Development Team	Date: Signature:	May 20th, 2005
Agreed by	L.VALENZIANO LFI 4K RL Development Team	Date: Signature:	May 20th, 2005
Agreed by	C. BUTLER LFI Program Manager	Date: Signature:	May 20th, 2005
Approved by	N. MANDOLES LFI Principal Investigator	Date: Signature:	May 20th, 2005



DISTRIBUTION LIST

Recipient	Company / Institute	E-mail address
T. PASSVOGEL	ESA – Noordwijk	tpassvog@estec.esa.nl
G. CRONE	ESA – Noordwijk	Gerald.Crone@esa.int
J. MARTI-CANALES	ESA – Noordwijk	Javier.Marti.Canales@esa.int
J. TAUBER	ESA – Noordwijk	Jan.Tauber@esa.int
J. RAUTAKOSKI	ESA – Noordwijk	Jan.Rautakoski@esa.int
B. COLLAUDIN	ALCATEL – Cannes	bernard.collaudin@space.alcatel.fr
J.P. CHAMBELLAND	ALCATEL – Cannes	Jean-Philippe.Chambelland@space.alcatel.fr
N. MANDOLESI	IASF/INAF – Bologna	mandolesi@bo.iasf.cnr.it
C. BUTLER	IASF/INAF – Bologna	butler@bo.iasf.cnr.it
M. BERSANELLI	UNIMI – Milano	Marco.bersanelli@mi.infn.it
D. MENNELLA	UNIMI – Milano	mennella@mi.iasf.cnr.it
M. TOMASI	IASF/INAF – Milano	tomasi@mi.iasf.cnr.it
M. BALASINI	ALENIA SPAZIO – LABEN	balasini.m@laben.it
G. CAFAGNA	ALENIA SPAZIO – LABEN	cafagna.g@laben.it
M. MICCOLIS	ALENIA SPAZIO – LABEN	miccolis.m@laben.it
R. SILVESTRI	ALENIA SPAZIO – LABEN	silvestri.r@laben.it
P. LEUTENEGGER	ALENIA SPAZIO – LABEN	leutenegger.p@laben.it
L. PAGAN	ALENIA SPAZIO – LABEN	pagan.l@laben.it
4KRL Team - Bologna	INAF/IASF – Bologna	
RWG members		rwg@beta.jpl.nasa.gov
LFI SPCC	IASF/INAF – Bologna	lfispcc@bo.iasf.cnr.it





CHANGE RECORD

[illegible]



TABLE OF CONTENTS

1	SCOPE	1
1.1	PURPOSE	1
1.2	DOCUMENT OVERVIEW	1
1.3	TERMS AND ACRONYMS	1
2	APPLICABLE AND REFERENCE DOCUMENTS.....	2
2.1	APPLICABLE DOCUMENTS	2
2.2	REFERENCE DOCUMENTS	2
3	FAILURE REPORT	3
4	FAILURE ANALYSIS	7
5	TEST PLAN.....	12
5.1	TEST ON ECCOSORB SAMPLES	12
5.1.1	<i>Chemical test 1: immersion in acetone</i>	<i>12</i>
5.1.2	<i>Chemical test 2: immersion in isopropyl alcohol</i>	<i>12</i>
5.1.3	<i>Chemical test 3: acetone + ultrasound cleaning</i>	<i>12</i>
5.1.4	<i>Chemical test 4: isopropyl alcohol + ultrasound cleaning</i>	<i>12</i>
5.1.5	<i>Effect of ultrasound cleaning on bulk material.....</i>	<i>12</i>
6	TEST PROCEDURE	12
7	GENERAL TEST CONDITION	13
7.1	AMBIENT	13
7.2	TEST INSTRUMENT	13
7.2.1	<i>Ultrasonic cleaning bath.....</i>	<i>13</i>
7.3	VISUAL INSPECTION.....	14
8	TEST PROCEDURE	15
8.1	TEST A – ULTRASONIC ACETONE BATH	15
8.2	TEST B – ACETONE BATH	15
8.3	TEST C – ULTRASONIC WATER BATH.....	15
8.4	TEST D – WATER BATH	16
8.5	TEST E – TOLUENE BATH.....	16
8.6	TEST F – GE GLUE (REACTIVATE WITH TOLUENE) TEST	16
9	TEST SPECIMENS.....	18
10	TEST REPORT	19
10.1	SPECIMEN 1A – CROSS @44GHZ ACETONE&ULTRASOUND.....	19
10.2	SPECIMEN 1B – PYRAMIDS @44GHZ ACETONE&ULTRASOUND.....	21
10.3	SPECIMEN 2 – CROSS @30GHZ ACETONE&ULTRASOUND	24
10.4	SPECIMEN 3A – CROSS@30GHZ ACETONE	27





10.5	SPECIMEN 3B – CROSS@44GHZ ACETONE	29
10.6	SPECIMEN 4 – SANDWICH AL6061-ECR110-ECR BONDED ACETONE.....	31
10.7	SPECIMEN 5A – BASE@44GHZ ACETONE&ULTRASOUND	32
10.8	SPECIMEN 5B – SANDWICH AL6061-ECR110-ECR BONDED ACETONE&ULTRASOUND	33
10.9	SPECIMEN 6 – CROSS@30GHZ WATER&ULTRASOUND	34
10.10	SPECIMEN 7 – BASE@44GHZ ACETONE.....	35
10.11	SPECIMEN 8 – BASE@30GHZ ACETONE.....	37
10.12	SPECIMEN 9 – BULK TOLUENE.....	38
10.13	SPECIMEN 10 – PYRAMID ACETONE	41
10.14	SPECIMEN 11 – PLATE WATER&ULTRASOUND.....	42
10.15	SPECIMEN 12 – BULK WATER	43
10.16	SPECIMEN 13 – BULK GE GLUE REACTIVATED	44





1 SCOPE

1.1 Purpose

A failure on some of the 4KRL QM parts was observed after the cryo cycles. A detailed activity was started to study the failure, to identify its causes, to find a solution before the assembly of the FM unit.

The purpose of this document is to report details of the failure, to describe the experimental activity to solve the problem, to report the results of this activity.

1.2 Document Overview

1.3 TERMS and ACRONYMS

4K RL	4K Reference Load
CMB	Cosmic Microwave Background
EBB	Elegant Bread Board
FEM	Front End Module
FM	Flight Model
FPU	Focal Plane Unit
FS	Flight Spare
HFI	High Frequency Instrument
I/F	Interface
IL	Insertion Loss
LFI	Low Frequency Instrument
MS	Mounting Structure
N/A	Not Applicable
PD	Prototype Demonstrator
QM	Qualification Model
RH	Reference Horn
RL	Return Loss
RT	Reference Target
SS	Spin-Synchronous
TBC	To Be Confirmed
TBD	To Be Defined
TBR	To Be Refined
ThL	Thermal Link
WG	Waveguide





2 APPLICABLE AND REFERENCE DOCUMENTS

2.1 *Applicable documents*

- AD 1: FIRST/Planck Instrument Interface Document, Part A (SCI-PT-IIDA-04624, 2/0)
- AD 2: FIRST/Planck Instrument Interface Document, Part B (SCI-PT-IIDB/LFI-04142, 2/0)
- AD 3: LFI Interface Control Document (PL-LFI-PST-ID-010, 2.0)
- AD 4: LFI/HFI Interface Document (PL-LFI-PST-ID-001, 1.0)
- AD 5: LFI Specification (PL-LFI-PST-SP-001, 3.0)
- AD 6: Planck LFI Instrument Design and Development Plan (PL-LFI-PST-PL-002, 2.0)
- AD 7: Planck LFI Product Assurance Plan (PL-LFI-PST-PL-003, 3.0)
- AD 8: Planck LFI Assembly Integration & Verification Plan (PL-LFI-PST-PI-004, 3.0)
- AD 9: FIRST/Planck Operations Interface Requirements Document (SCI-PT-RS-07360, 2/1)
- AD 10: LFI Configuration and Data Management CADM Plan (PL-LFI-PST-PL-001, 3.0)
- AD 11: LFI Instrument Deliverable Documentation List (DDL) (PL-LFI-PST-LI-007, 1.0)
- AD 12: 4K Reference Load Requirement Specification (PL-LFI-TES-SP-001, 2.0)

2.2 *Reference documents*





3 FAILURE REPORT

Some cracks on the ECCOSORB CR110 cross have been observed on one of the 30GHz targets (id parte) after the 15th thermal cycle to 4K. Flakes are also visible.

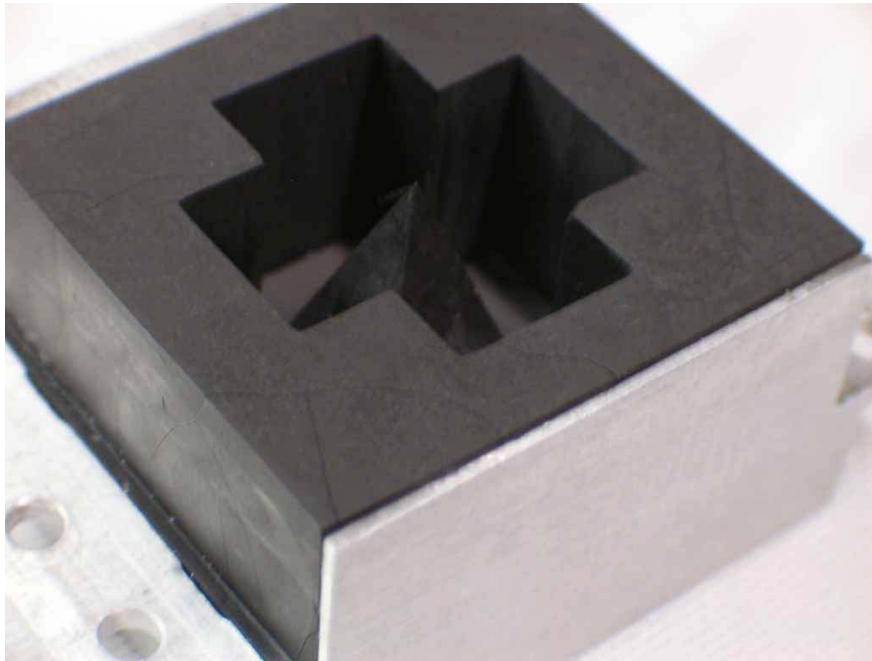


Figure 1: Images of the damaged target after the cryo cycles.

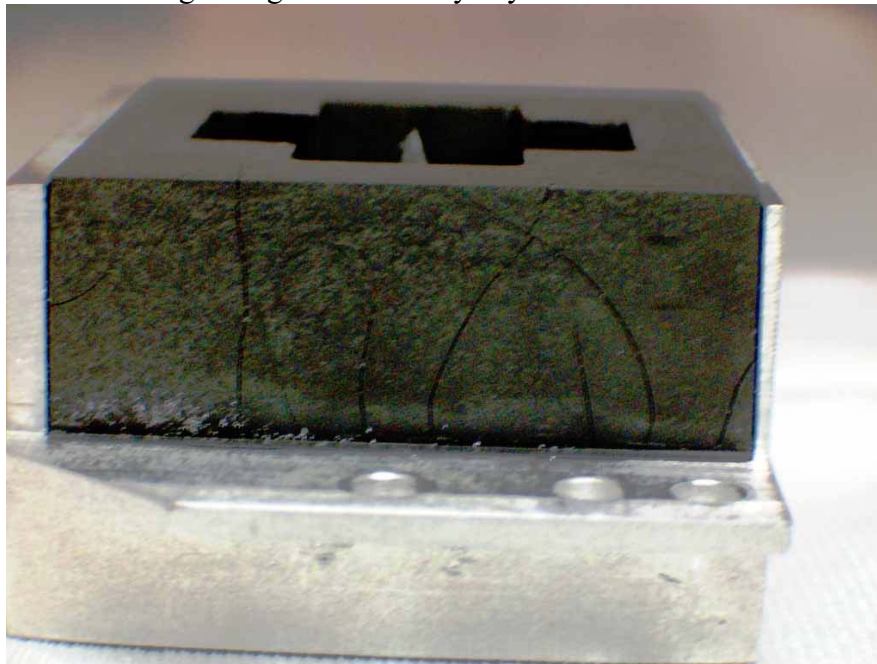


Figure 2: Lateral view of the damaged target

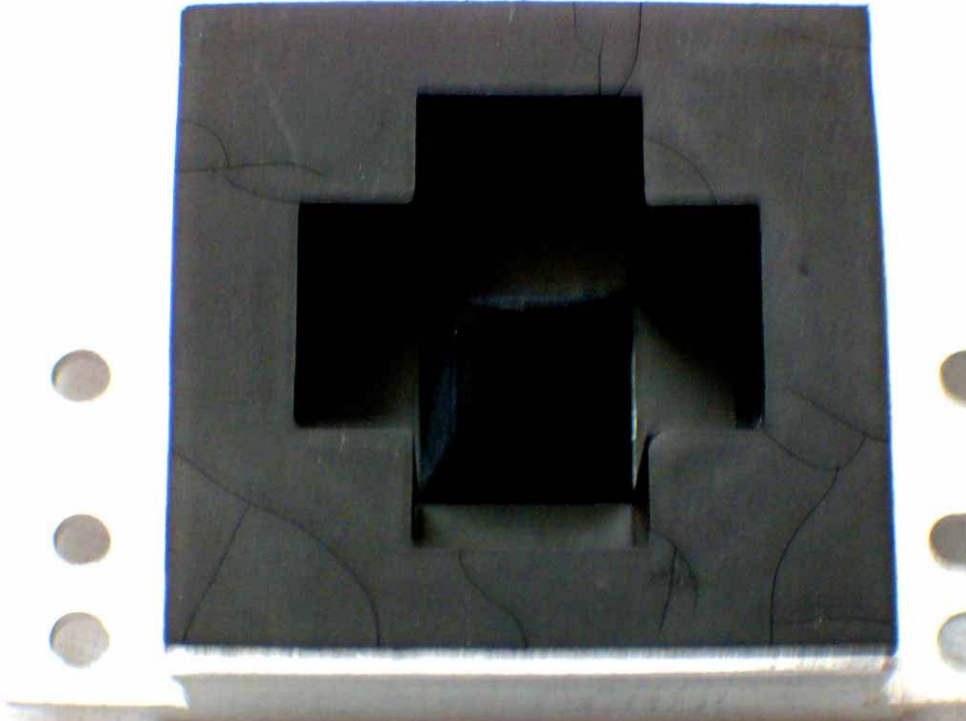


Figure 3: Another view of the damaged 30GHz target

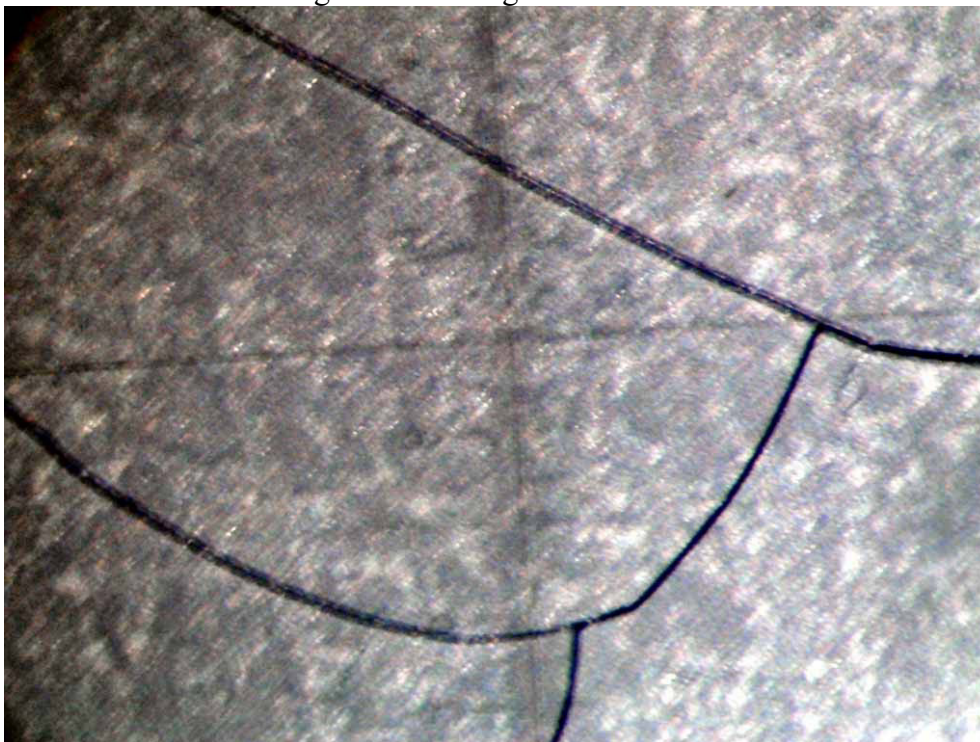


Figure 4: Details of some of the cracks view through a microscope.

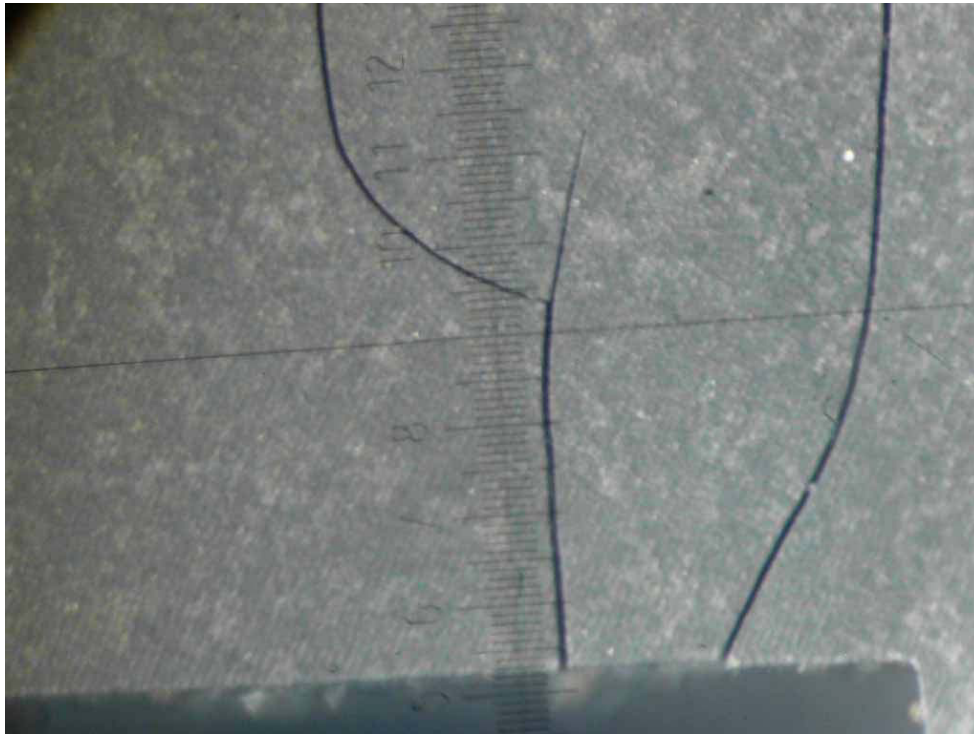


Figure 5: Details of some of the cracks view through a microscope: a reference scale is also visible.

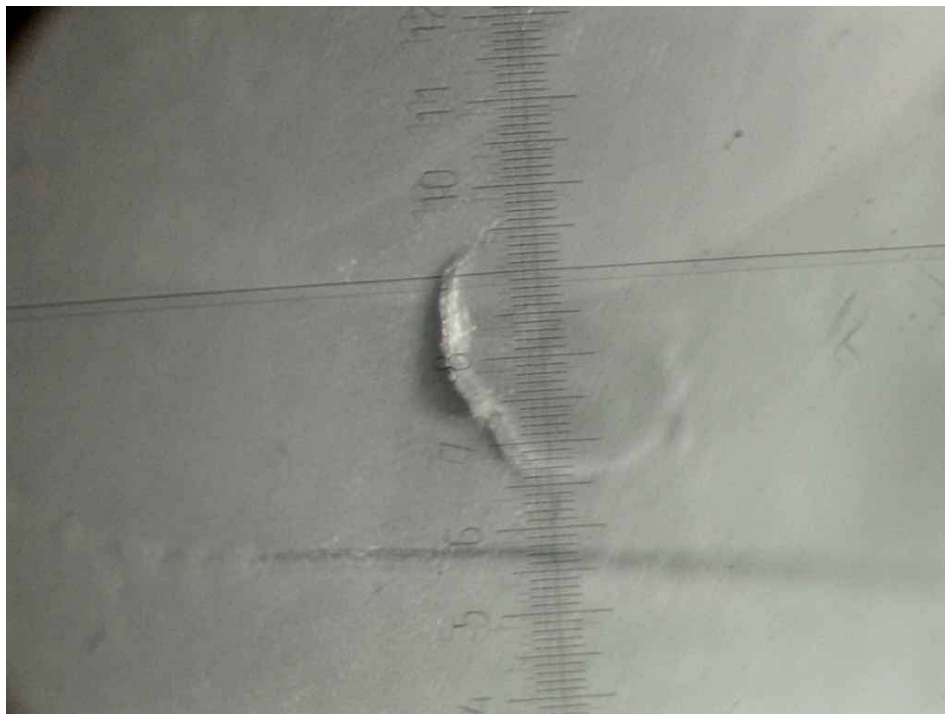


Figure 6: Details of one of the flakes view through a microscope



Figure 7: Details View through a microscope of the crack on the 44 GHz target (id parte)



4 FAILURE ANALYSIS

The failure was analysed for possible causes. Analisi del failure del target a 30GHz durante i cicli termici

L. Valenziano – IASF-Bo

4/3/2005

‘Failure tree’ is reported in XX. It is compiled considering all the possible factors which can have been causes of the failure. They have then been studied to identify the actual problem areas and divide them in different level risk. Color code is as follows:

- Green boxes refer to excluded causes.
- Light blue boxes refer to possible causes (needs to be further investigated).
- Orange boxes indicate high probable causes (need to be considered).
- Red boxes indicate identified problem areas (mandatory to solve).

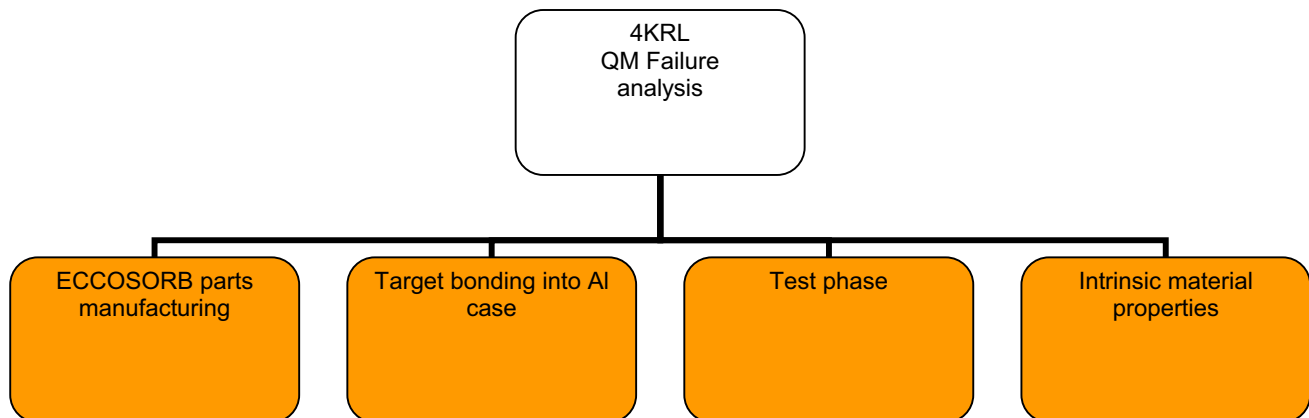



Figure 8: High level failure analysis tree

Albero di analisi del failure (livelli superiori – riepilogo)



ECCOSORB failure analysis


Document No.: PL-LFI-TES-TN-015
Issue/Rev. No.: 1.0
Date: May 2005
Page: 8

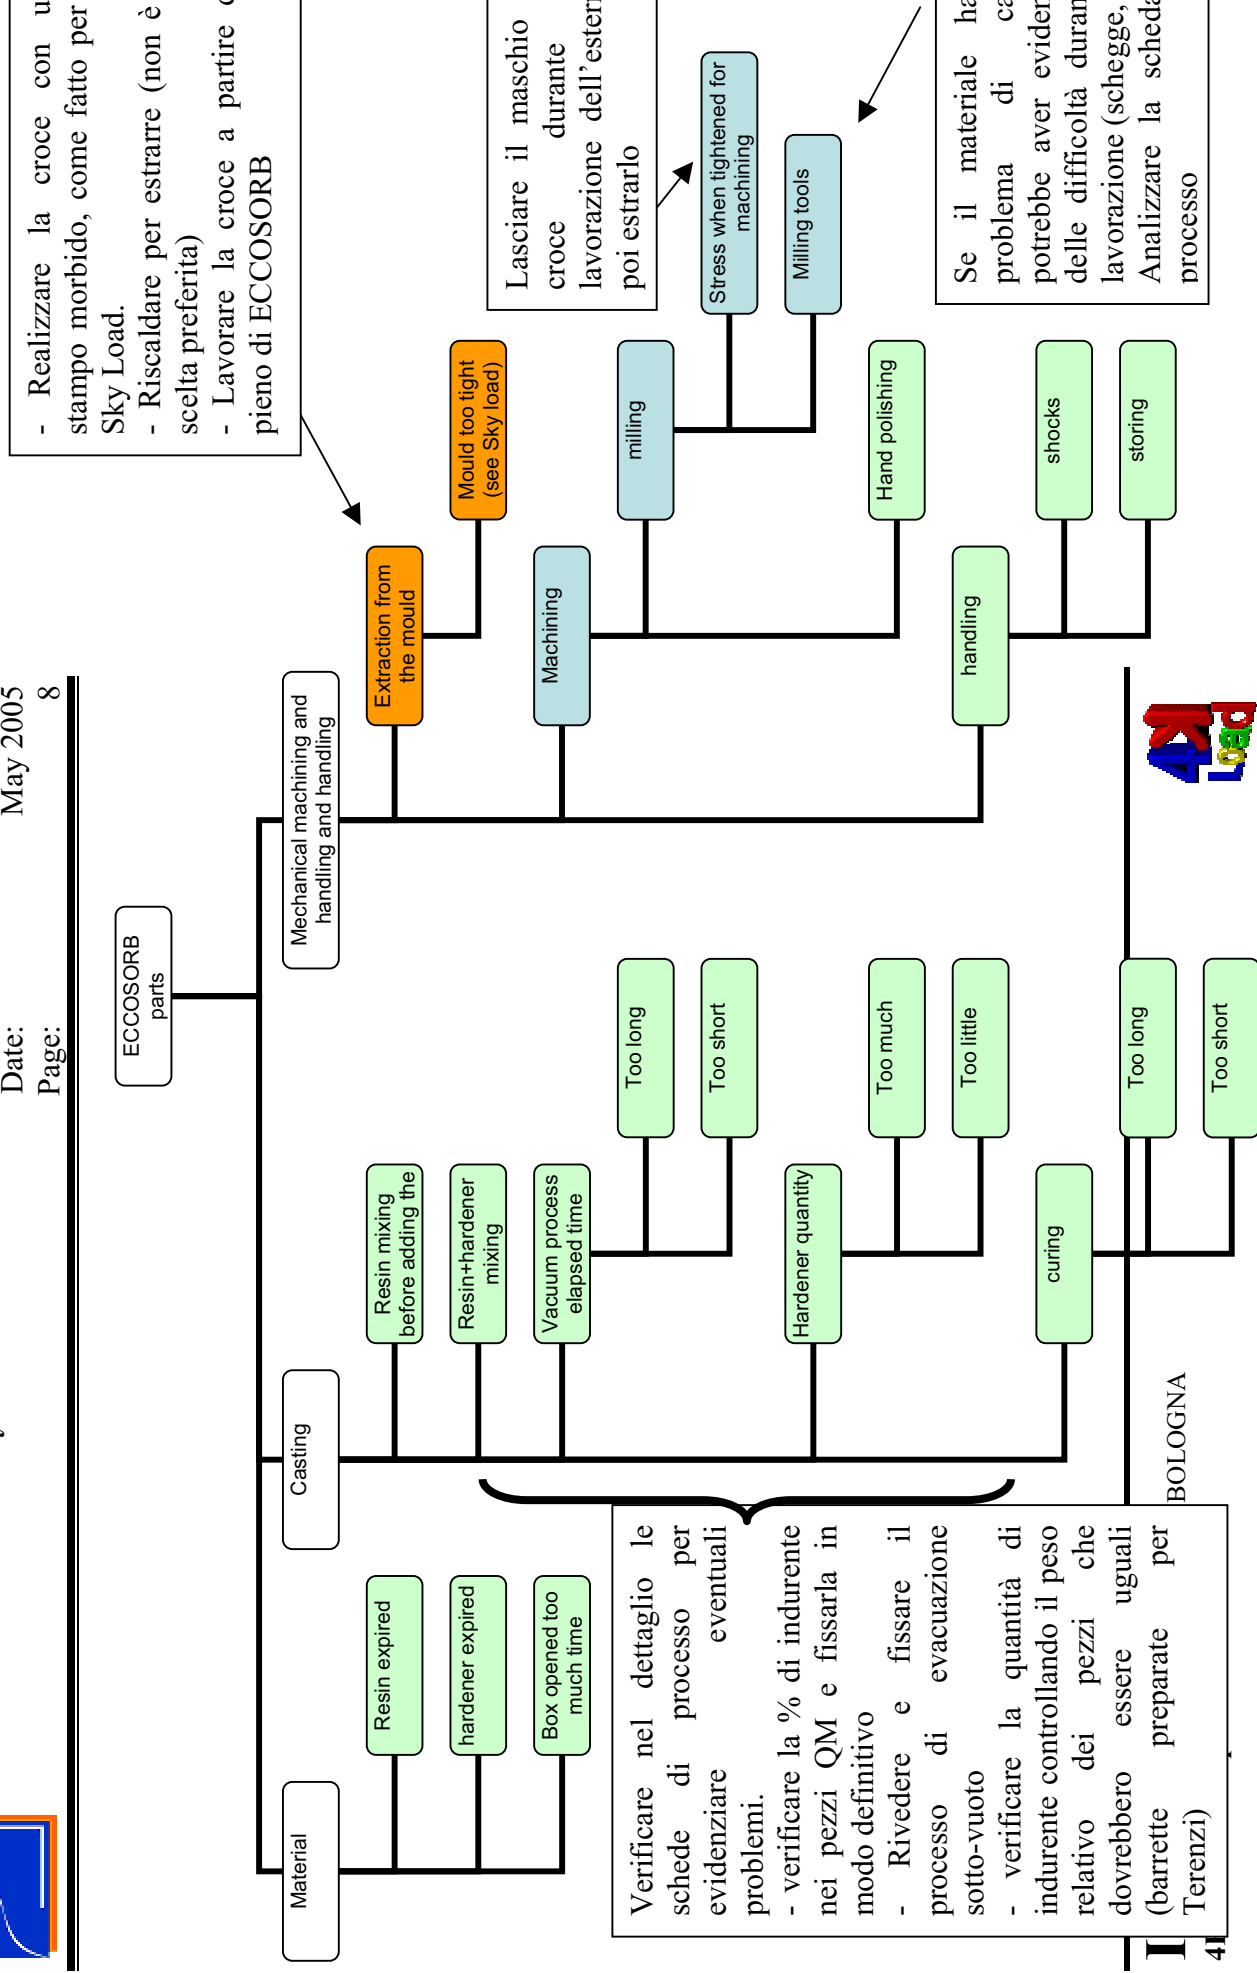




ECCOSORB failure analysis

Document No.: PL-LFI-TES-TN-015
Issue/Rev. No.: 1.0
Date: May 2005
Page: 9

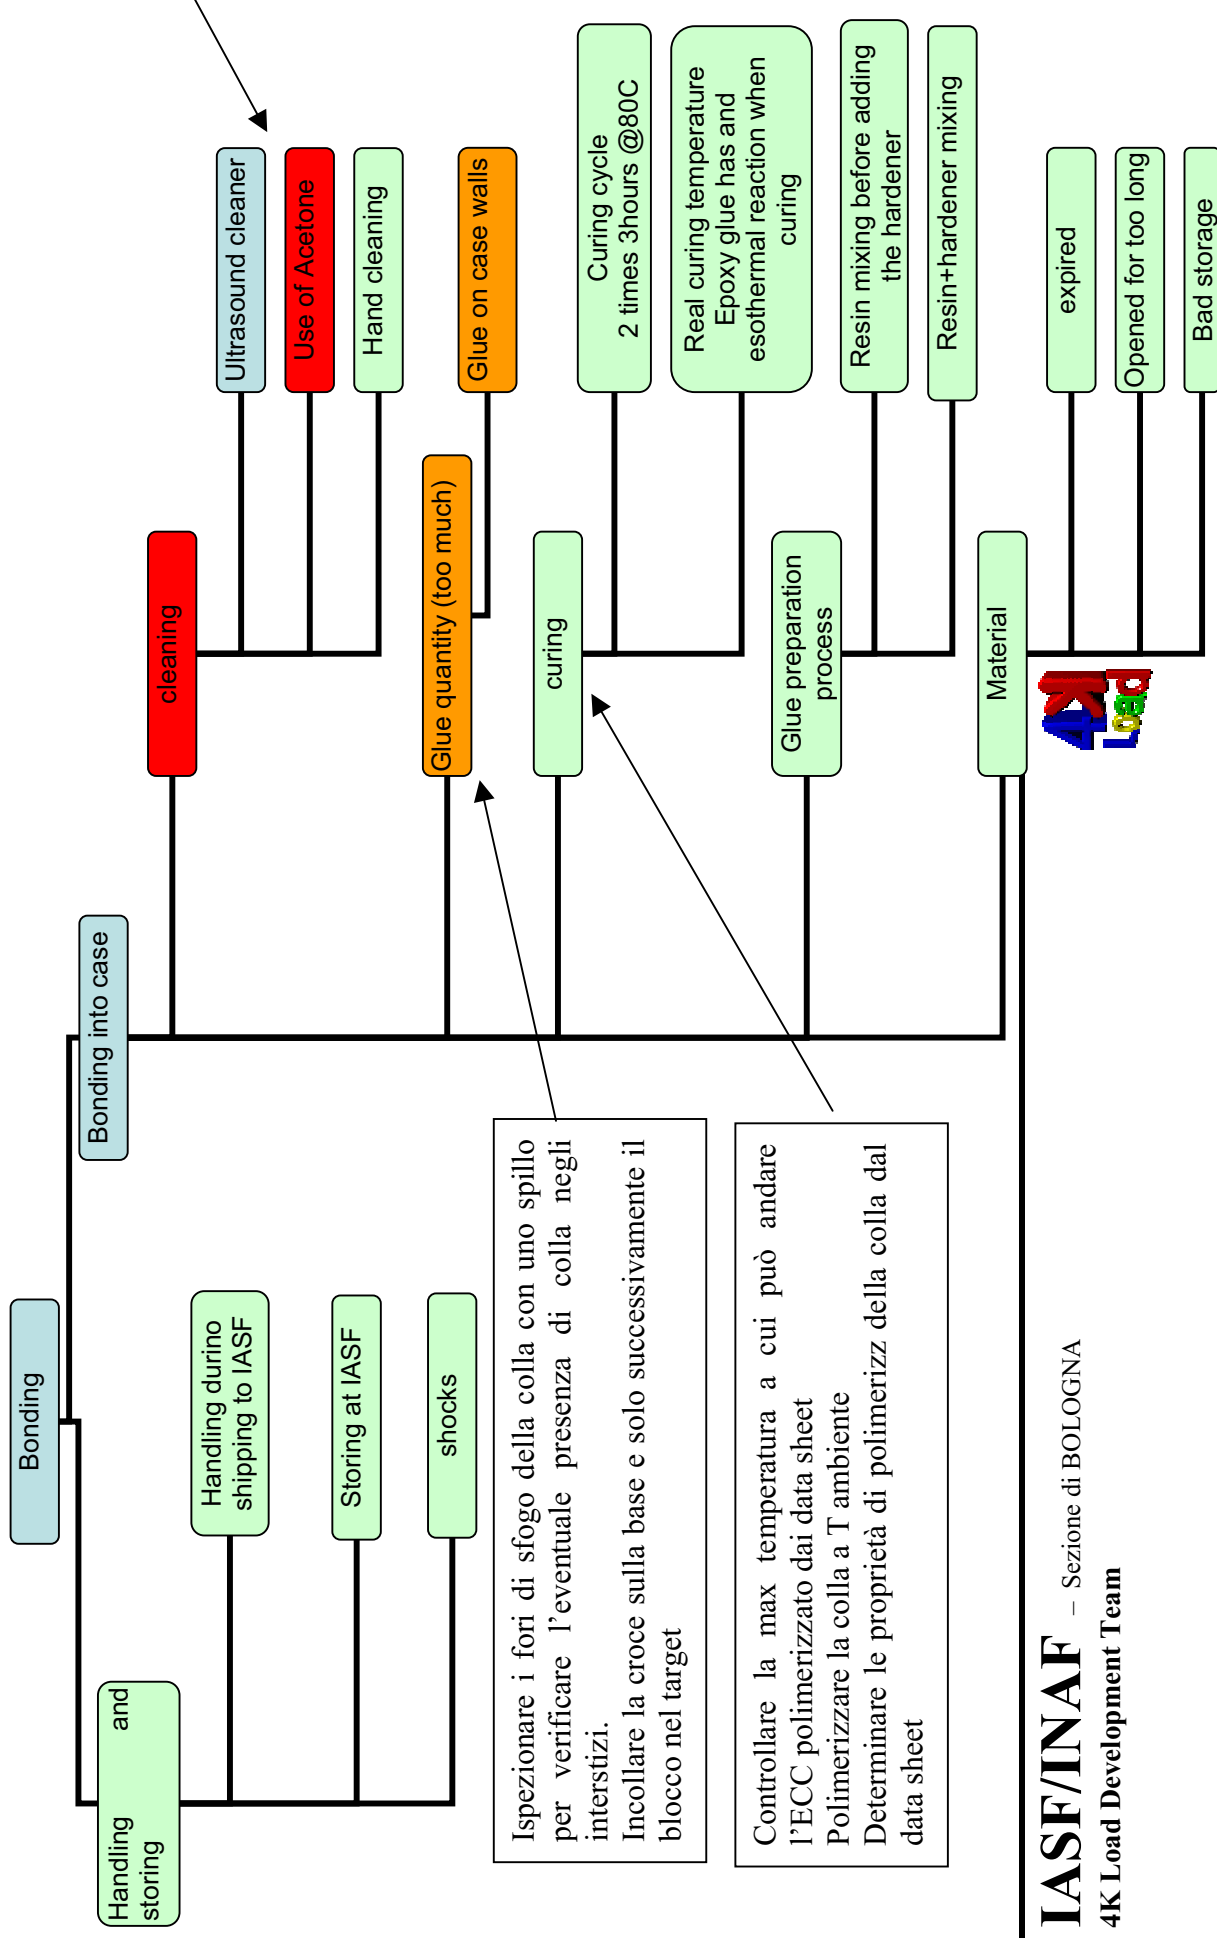


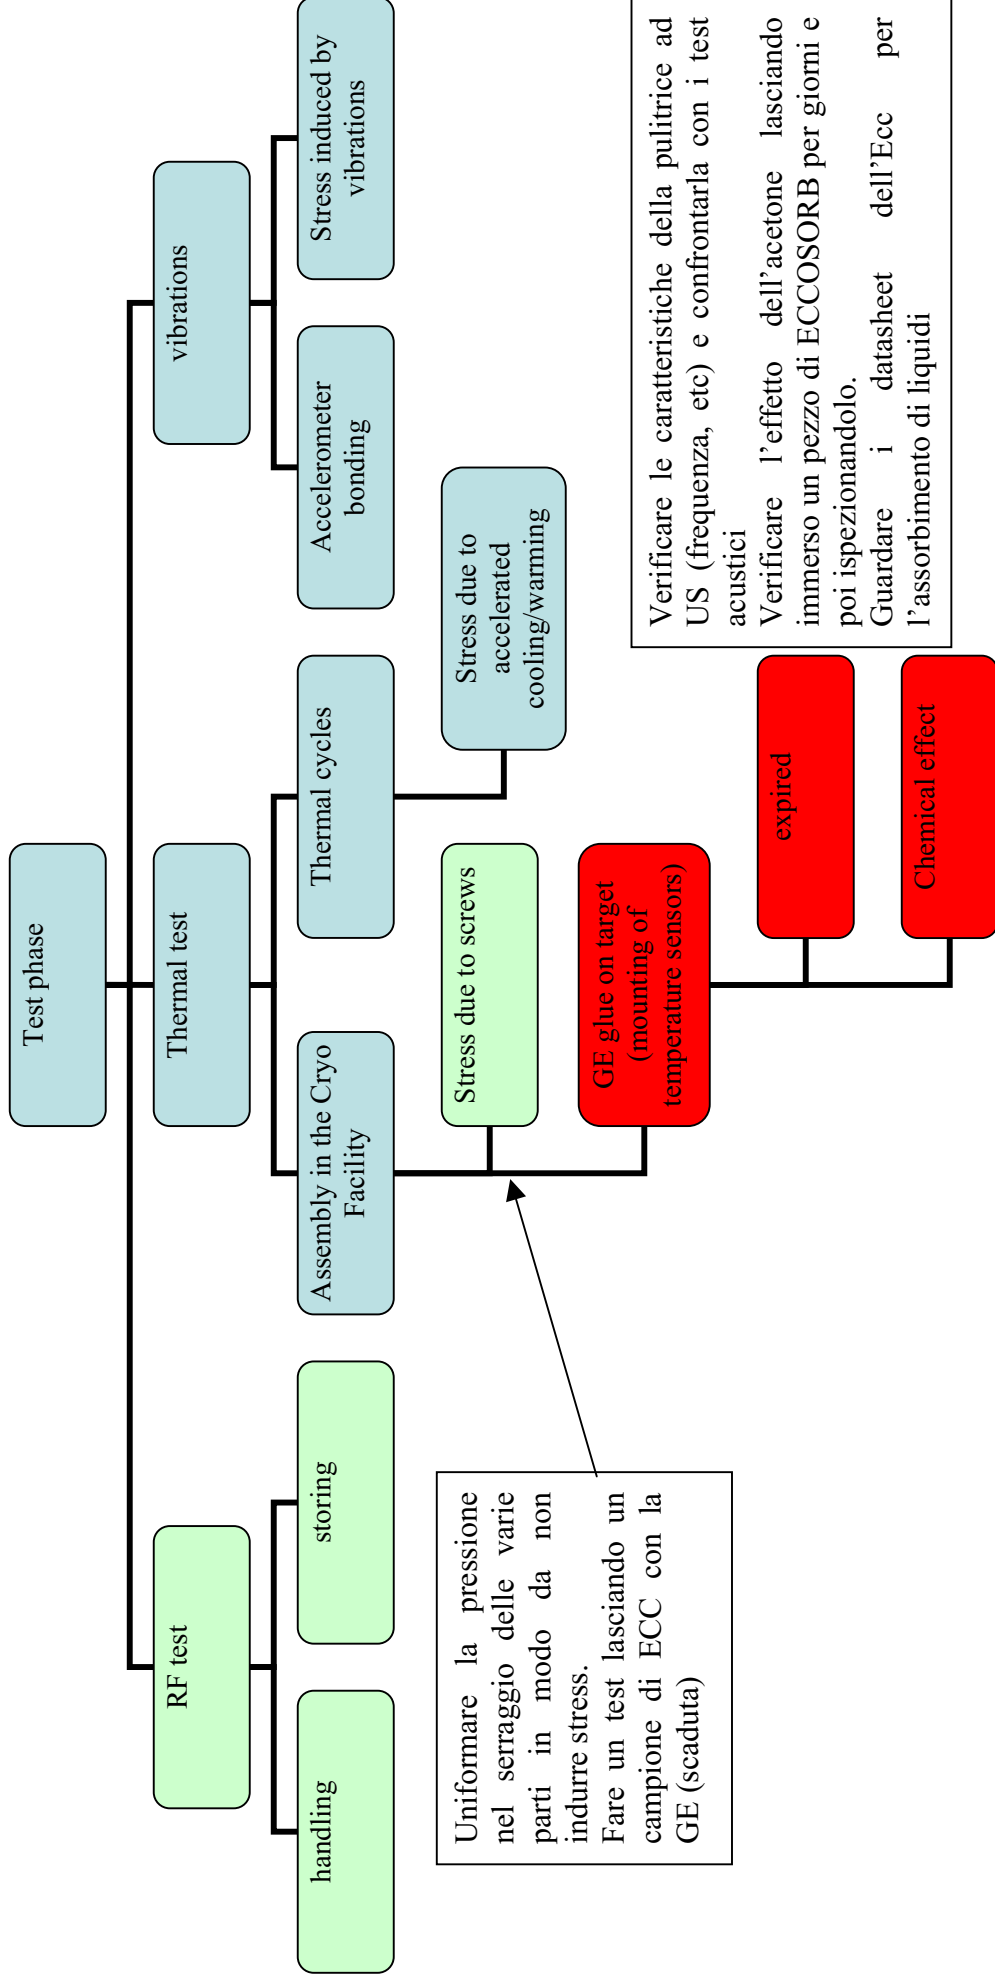



ECCOSORB failure analysis

Document No.: PL-LFI-TES-TN-015
Issue/Rev. No.: 1.0
Date: May 2005
Page: 11

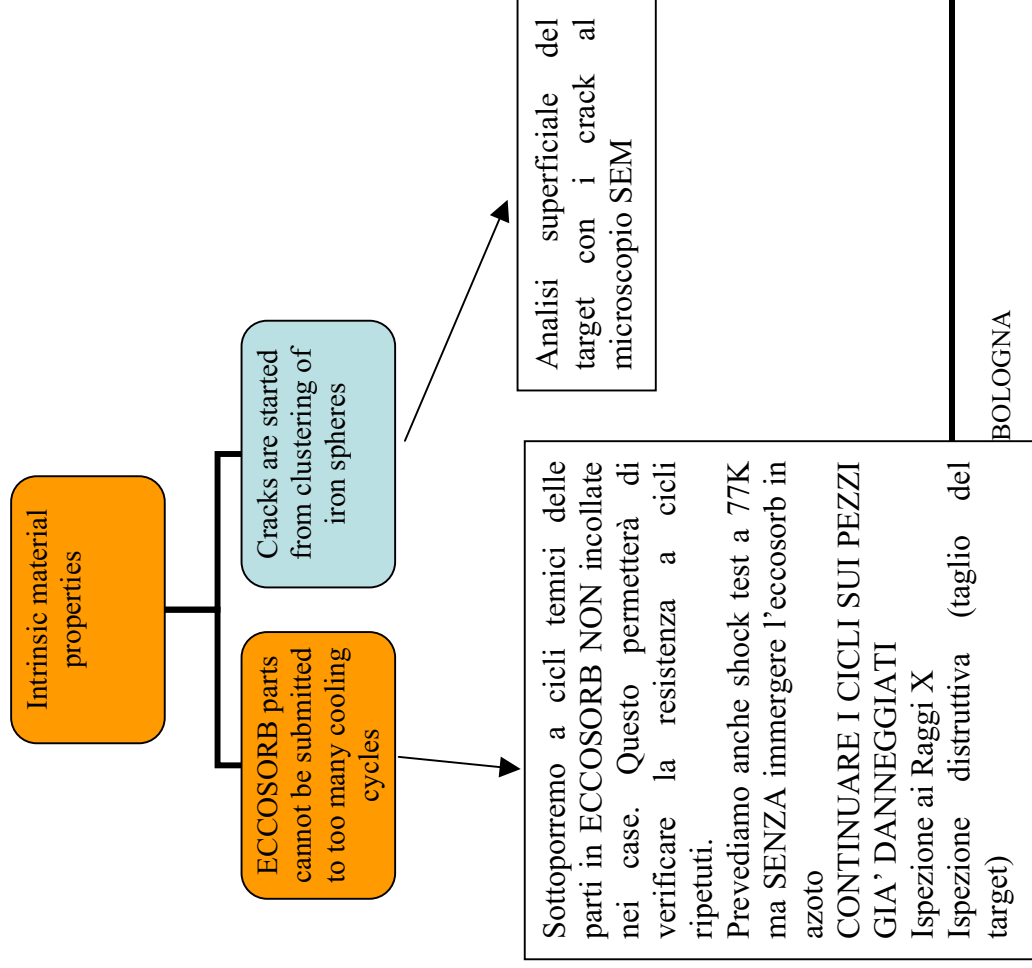

BOLOGNA





5 TEST PLAN

A number of test are foreseen to verify the effect of different chemical and physical causes on the ECCOSORB.

5.1 *Test on ECCOSORB samples*

Samples of material (small blocks) are obtained from bars produced in the same batch with proto-flight targets. These samples will be used to test the effect of different cleaning and test procedures on a bulk material.

5.1.1 Chemical test 1: immersion in acetone

Blocks will be immersed in acetone to test the effect on bulk material. Samples will be visually inspected at regular intervals to verify any damage occurred.

5.1.2 Chemical test 2: immersion in isopropyl alcohol

Blocks will be immersed in isopropyl alcohol to test the effect on bulk material. Samples will be visually inspected at regular intervals to verify any damage occurred.

5.1.3 Chemical test 3: acetone + ultrasound cleaning

Blocks will be immersed in acetone and then placed in a ultrasound cleaner to test the effect of sound-induced stress + chemical effect on bulk material. Samples will be visually inspected at regular intervals to verify any damage occurred.

5.1.4 Chemical test 4: isopropyl alcohol + ultrasound cleaning

Blocks will be immersed in isopropyl alcohol and then placed in a ultrasound cleaner to test the effect of sound-induced stress + chemical effect on bulk material. Samples will be visually inspected at regular intervals to verify any damage occurred.

5.1.5 Effect of ultrasound cleaning on bulk material

Block will be immersed in water and submitted to ultrasound cleaning to verify the effect of physical agents only. Samples will be visually inspected at regular intervals to verify any damage occurred.

6 TEST PROCEDURE





7 GENERAL TEST CONDITION

7.1 AMBIENT

All the test will be conducted in a clean room class 100000, or under a hood if required by safety condition.

Temperature [°C]	21
Humidity [%]	
Pressure [mmbar]	

7.2 TEST INSTRUMENT

7.2.1 Ultrasonic cleaning bath

The ultrasound cleaning cycle will be performed using a ultrasonic bath machine, model UTD-18, produced by Falc Instruments. The technical data are reported in the table below:

	UTD-18
Tank capacity [lt]	2.3
Frequency [kHz]	28.5/31
Peak power [W]	200
Power [W]	200
Heating amb +75°C	YES
Drain cock	YES
Timer [min]	2-22 (±5 sec.)
Internal dim L x W x H [mm]	135 x 297 x 65
Weight [kg]	4.5
Power supply [V @ Hz]	230 @50-60

Other technical data are available on www.flacstruments.it.





7.3 *VISUAL INSPECTION*

Unaided eye and microscope (up to 7x magnification).



8 TEST PROCEDURE

8.1 TEST A – ultrasonic acetone bath

A cleaning cycle of 22 minutes at 40°C will be performed in an acetone bath.
The cycles will be performed until a failure of the specimen, or after 12 cycles.
A visual inspection of the specimens will be done after each cycle.
The mass will be measured at last at the begin and at the end of the test.
The following table will be filled during the test.

DATE	TIME	TEST CONDITION	NOTE

8.2 TEST B – acetone bath

The specimen will be left in a backer with acetone for several hours until a failure, or after 100h
A visual inspection will be done after each 24h.
The mass will be measured at last at the begin and at the end of the test.
The following table will be filled during the test.

DATE	TIME	TEST CONDITION	NOTE

8.3 TEST C – ultrasonic water bath

A cleaning cycle of 22 minutes at 40°C will be performed in a water bath.
The cycles will be performed until a failure of the specimen, or after 8 cycles.
A visual inspection of the specimens will be done after each cycle.
The mass will be measured at last at the begin and at the end of the test.
The following table will be filled during the test.

DATE	TIME	TEST CONDITION	NOTE





8.4 TEST D – water bath

The specimen will be left in a backer with water for several hours until a failure, or after 100h
A visual inspection will be done
The mass will be measured at last at the begin and at the end of the test.
The following table will be filled during the test.

DATE	TIME	TEST CONDITION	NOTE

8.5 TEST E – toluene bath


The specimen will be left in a backer with water for several hours until a failure, or after 100h
A visual inspection will be done
The mass will be measured at last at the begin and at the end of the test.
The following table will be filled during the test.

DATE	TIME	TEST CONDITION	NOTE

8.6 TEST F – GE glue (reactivate with toluene) test

On the specimen will be the GE glue reactivate with toluene, in order to verify the effect of the GE with toluene on the material.
The mass will be measured at last at the begin and at the end of the test.
The following table will be filled during the test.

DATE	TIME	TEST CONDITION	NOTE

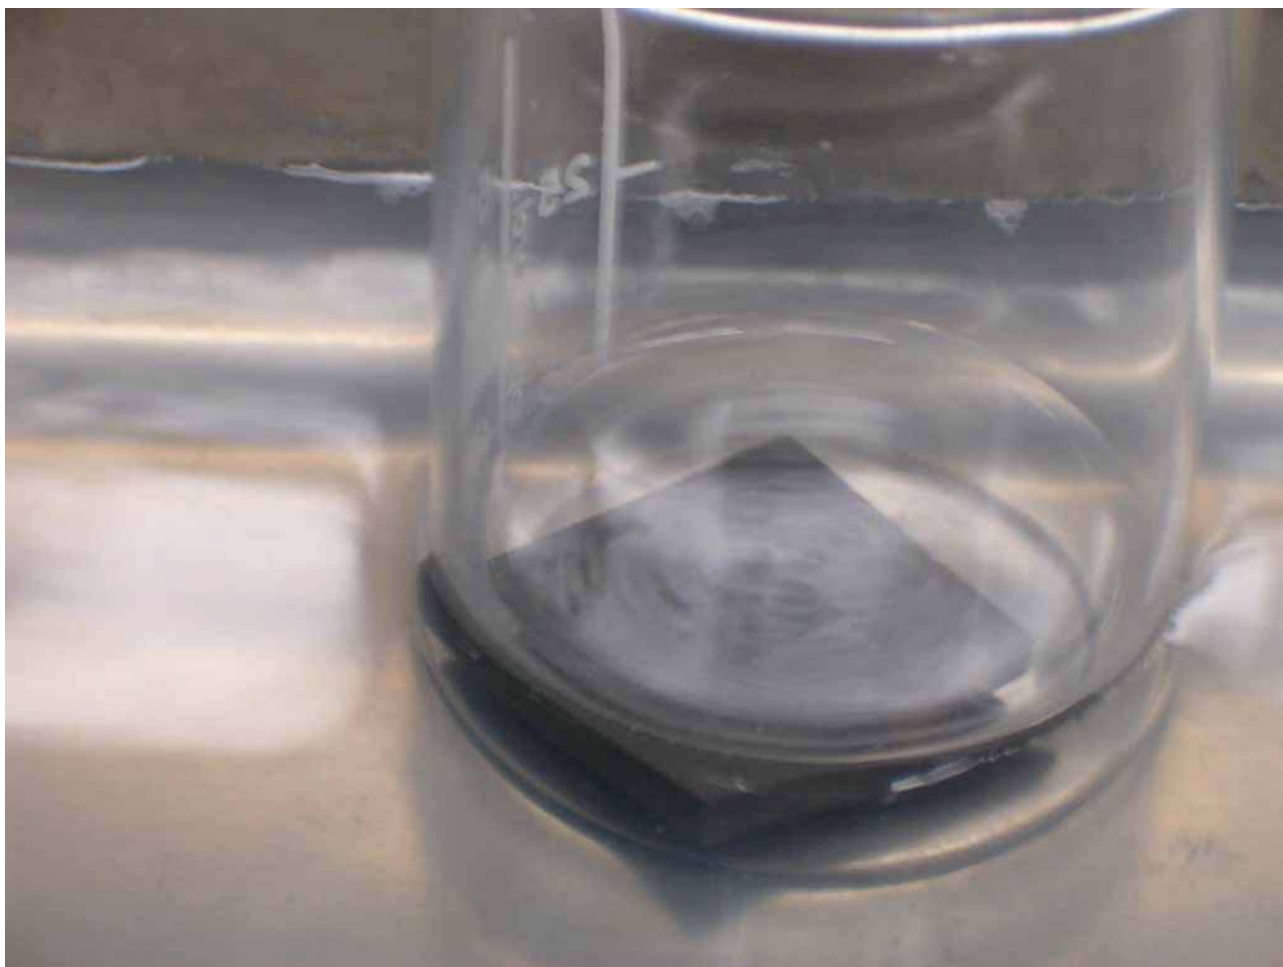

Test A



9 TEST SPECIMENS

The specimen used for the test are builded by Officine Pasquali, using Eccosorb CR110 or Eccosorb CR117. The specimens behaves to different batch and were builded in different years.

Specimen Number	Name	Material	Year	Test
1a	Cross @44GHz	ECR110		A
1b	Pyramids @44GHz	ECR110		A
2	Cross @30GHz	ECR110		A
3a	Cross @30GHz	ECR110		B
3b	Cross @44GHz	ECR110		B
4	Sandwich Al6061-ECR110 ECR bonded*	ECR110, Al6061		B
5a	Base @44GHz	ECR117		A
5b	Sandwich Al6061-ECR110 ECR bonded*	ECR110, Al6061		A
6	Cross @30GHz	ECR110		C
7	Base @44GHz	ECR117		B
8	Base @30Ghz	ECR117		B
9	Bulk	ECR110	2004	E
10	Pyramids	ECR110		B
11	Plate	ECR110	2004	C
12	Bulk	ECR110	2004	D
13	Bulk	ECR110	2004	F

*Specimens builded by IASF







10 TEST REPORT

10.1 Specimen 1a – Cross @44GHz acetone&ultrasound

DATE	TIME	TEST CONDITION	NOTE
09/03/05	11.00	21.4°C40%HR	Visual Inspection: There are 2 bubble one on the external edge and the other on the internal edge. Mass: 5.7[g]
09/03/05	11.20		Start a battery of 3 cycles of ultrasonic cleaning bath
09/03/05	12.30		End of cycles. Visual Inspection: The specimen has several cracks on all the edge. Mass: 5.7[g]

In the followings images is visible the specimens after all the test.

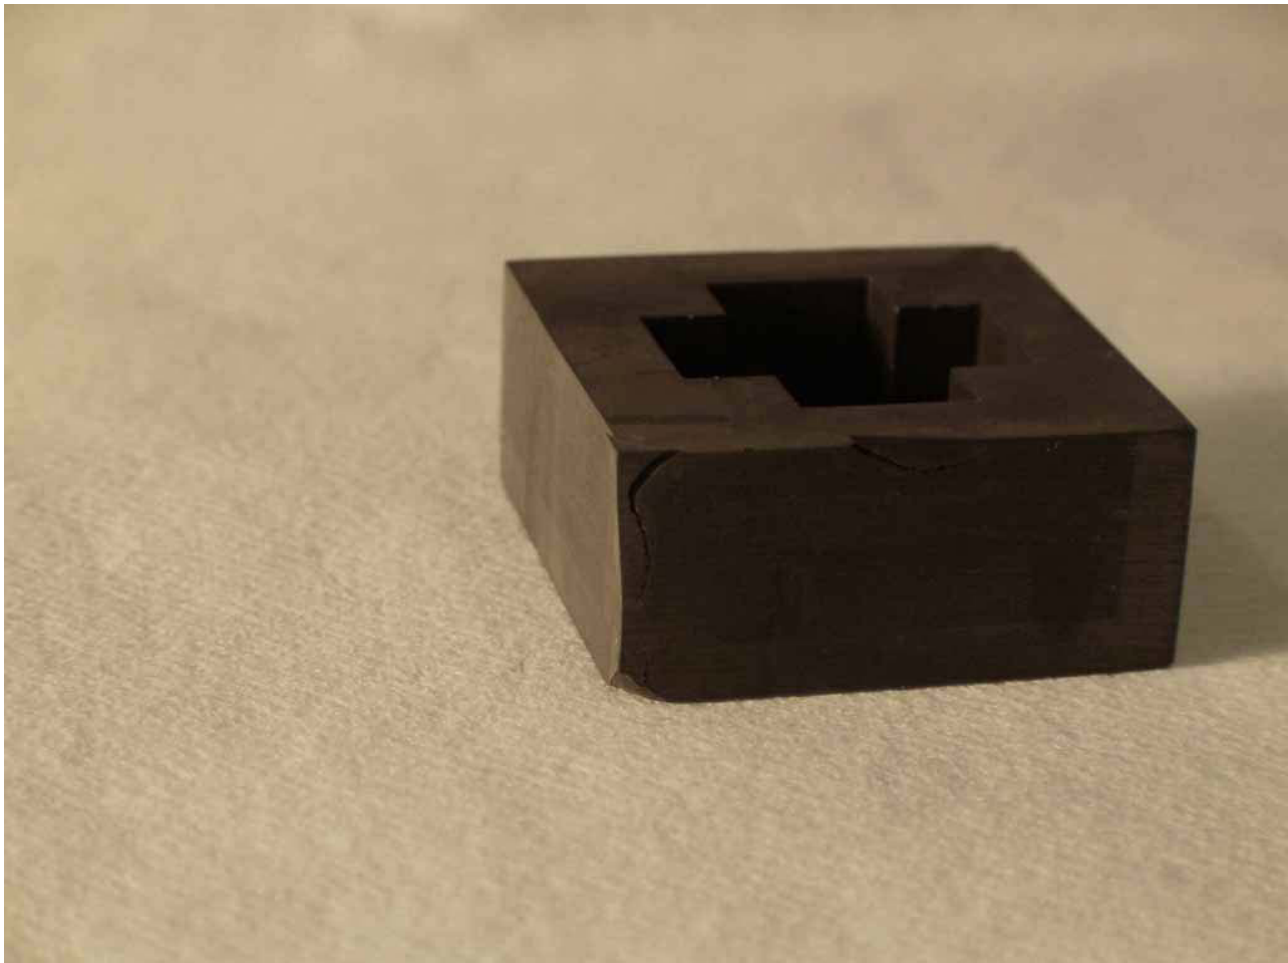

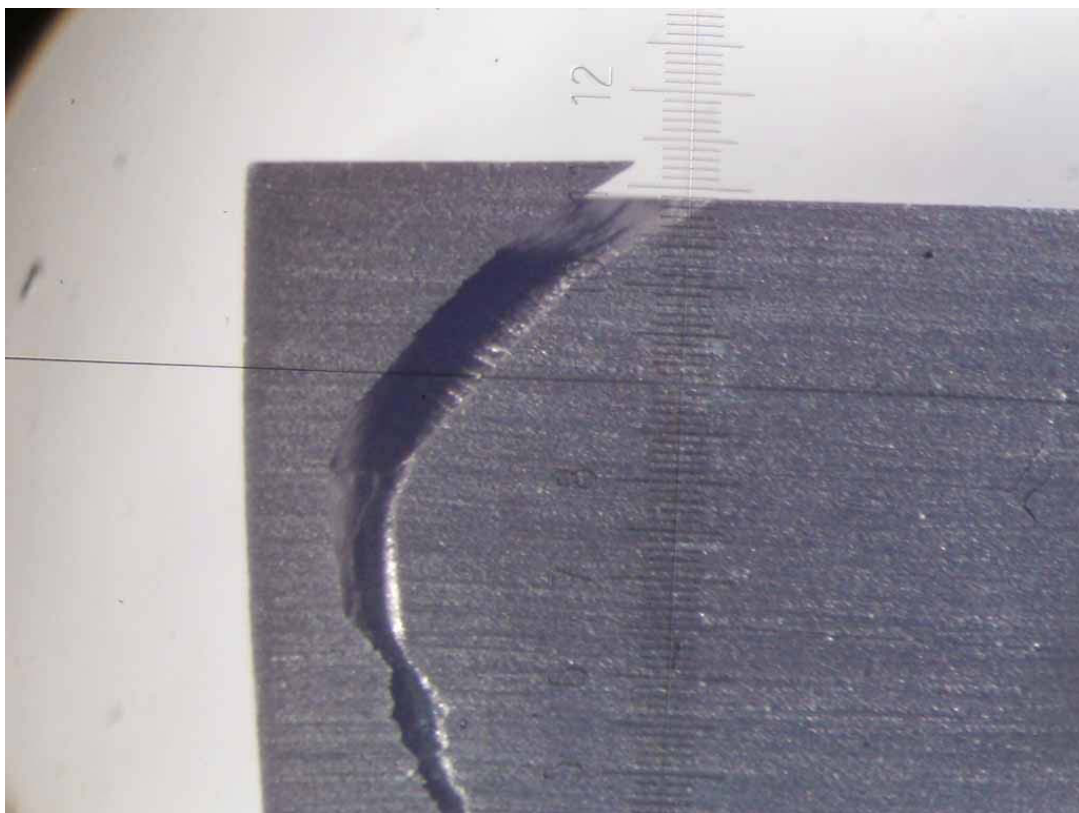






10.2 Specimen 1b – Pyramids @44GHz acetone&ultrasound

DATE	TIME	TEST CONDITION	NOTE
09/03/05	11.00	21.4°C40%HR	Visual Inspection: there aren't visible defects Mass: 0.5[g]
09/03/05	11.20		Start a battery of 3 cycles of ultrasonic cleaning bath
09/03/05	12.30		End of cycles. Visual Inspection: The specimen has several cracks on all edges. Mass: 0.5[g]

In the followings images is visible the specimen after all the test

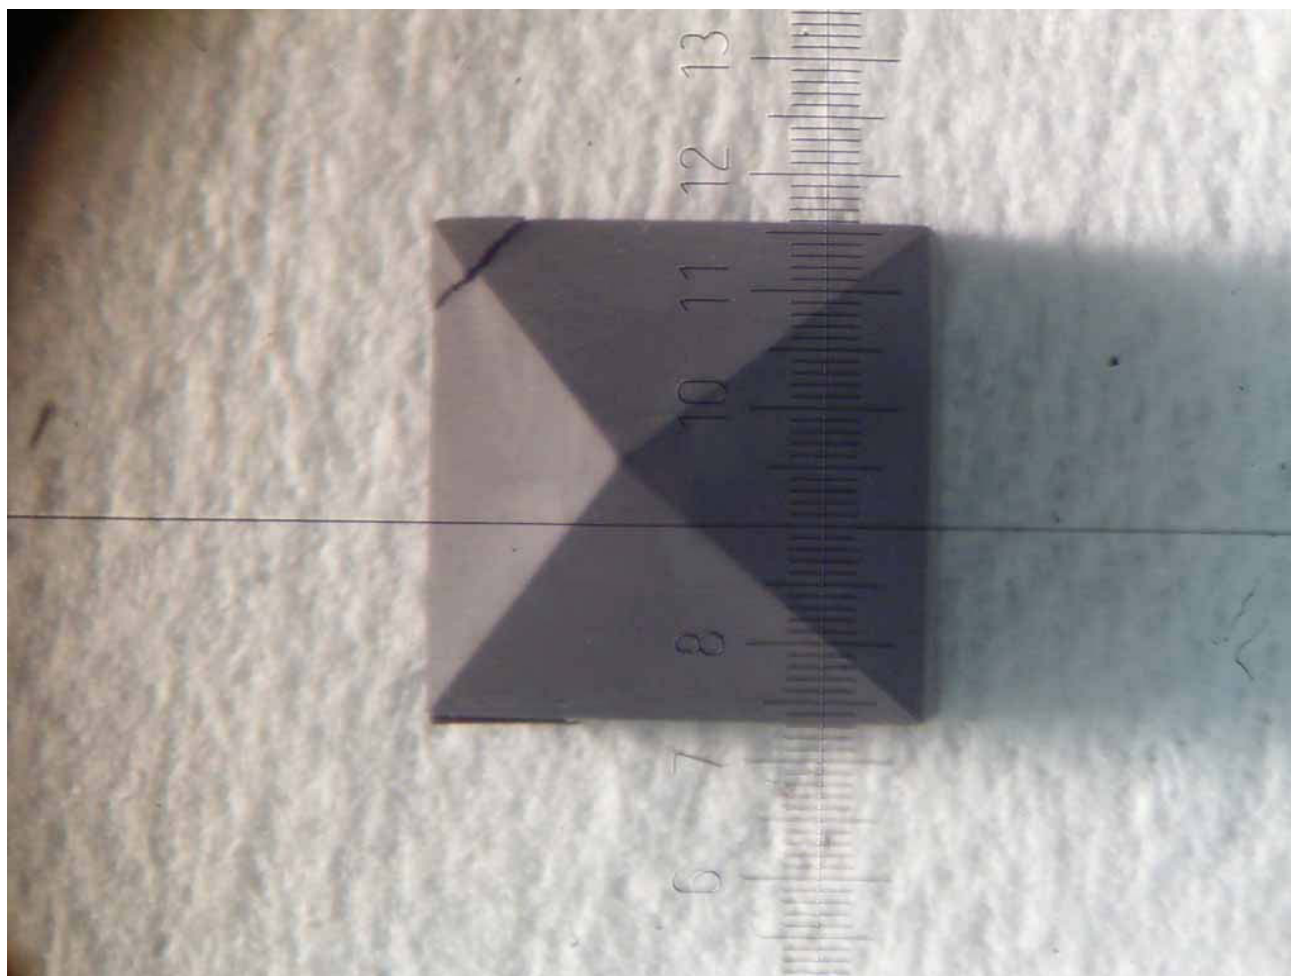

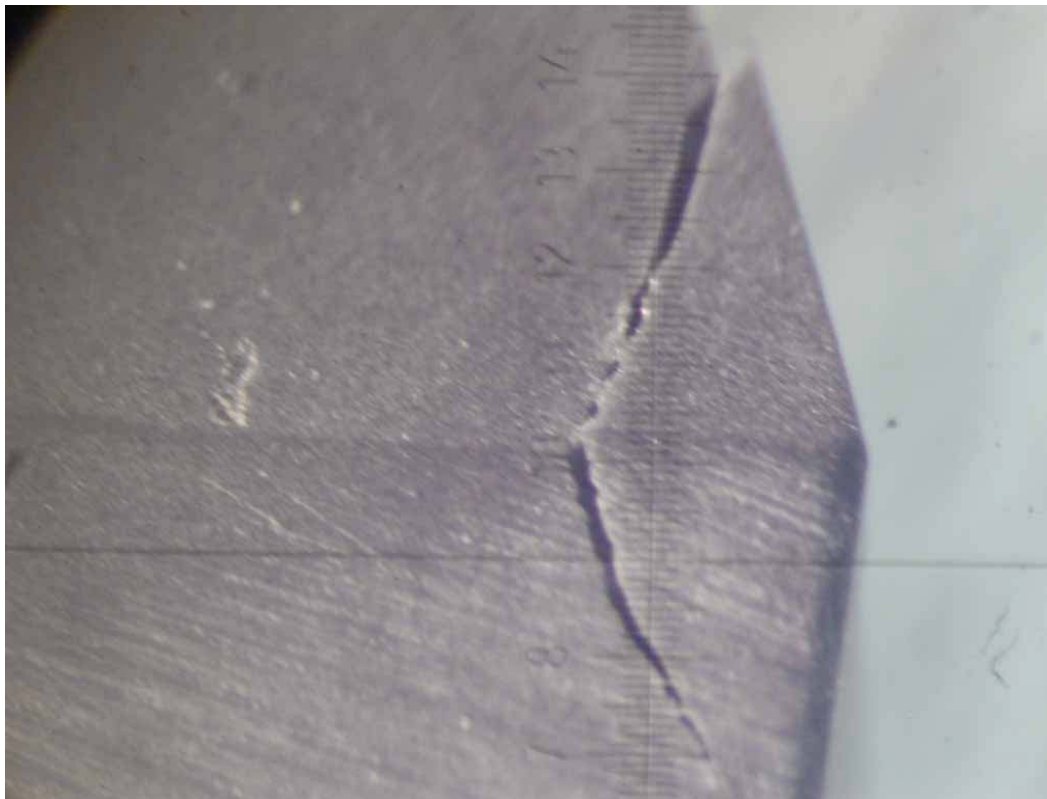

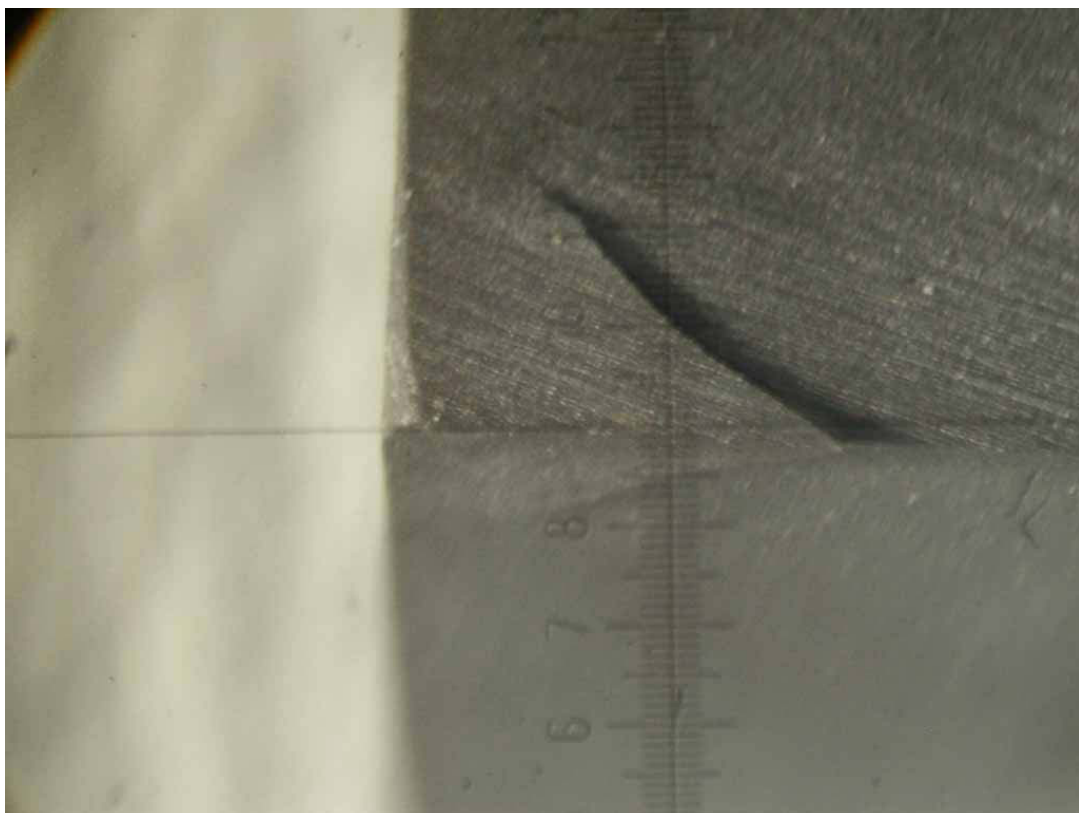






10.3 Specimen 2 – Cross @30GHz acetone&ultrasound

DATE	TIME	TEST CONDITION	NOTE
09/03/05	11.00	21.4°C40%HR	Visual Inspection: There are 2 blister on the external edge Mass: 16.5[g]
09/03/05	11.20		Start a sequence of 3 cycles of ultrasonic cleaning bath
09/03/05	12.30		End of the battery of the cycles. Visual Inspection: The specimen doesn't have any crack. Mass: 16.5[g]
09/03/05	16.30	21.6°C40%HR	Start the IV cycle of ultrasonic cleaning bath
09/03/05	17.00		End of the cycle Visual Inspection: There are visible cracks on all the edges

In the followings images is visible the specimen after the IV cycle

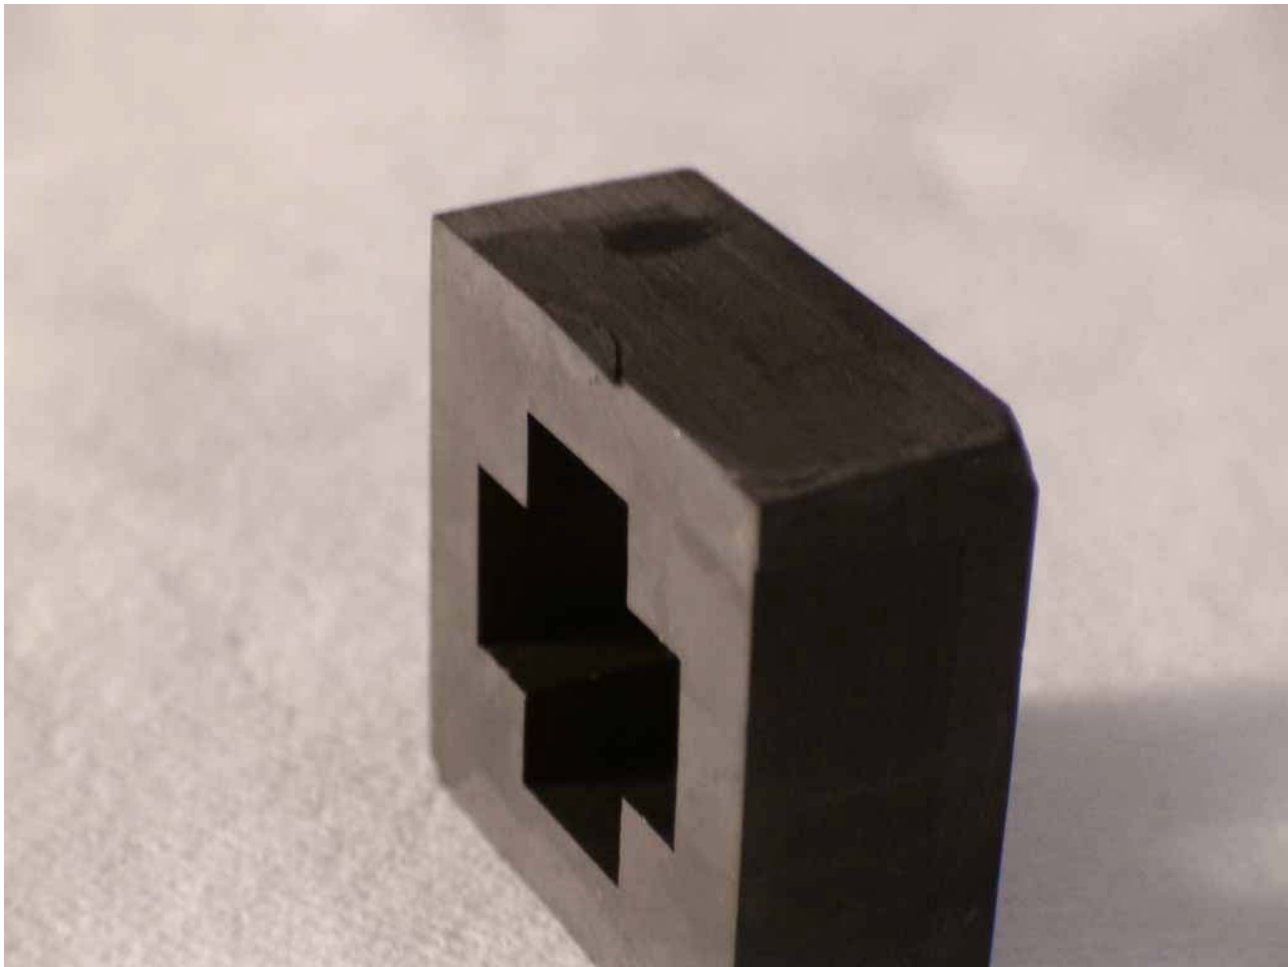

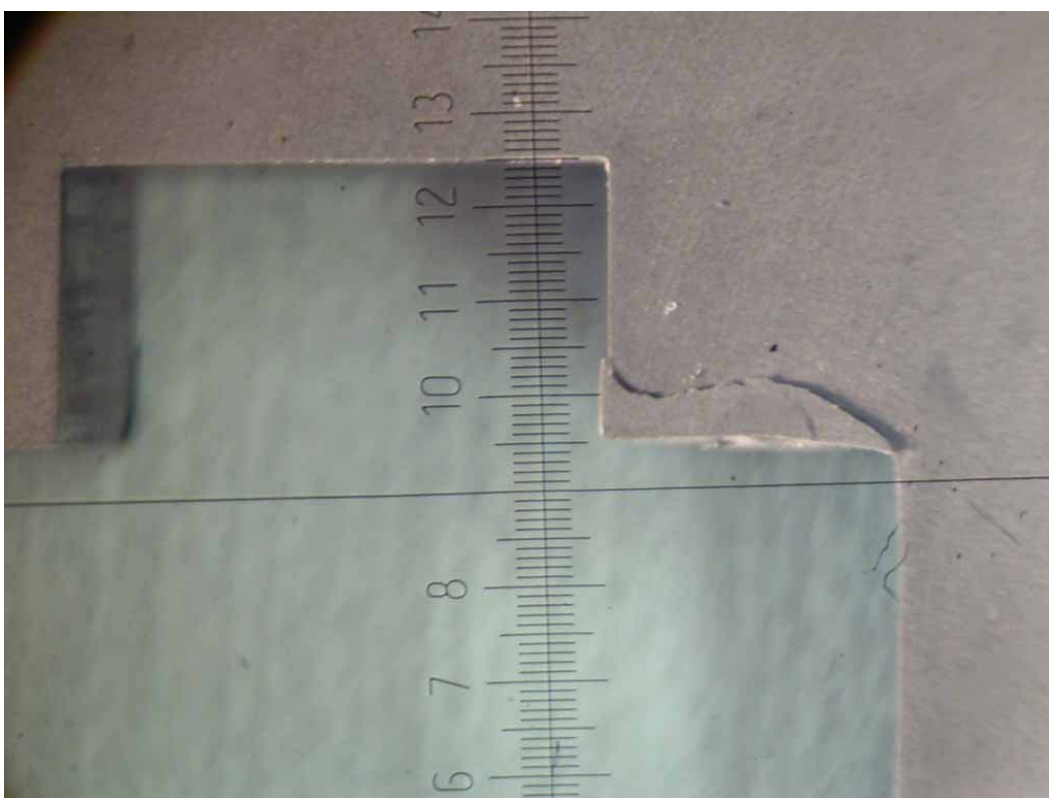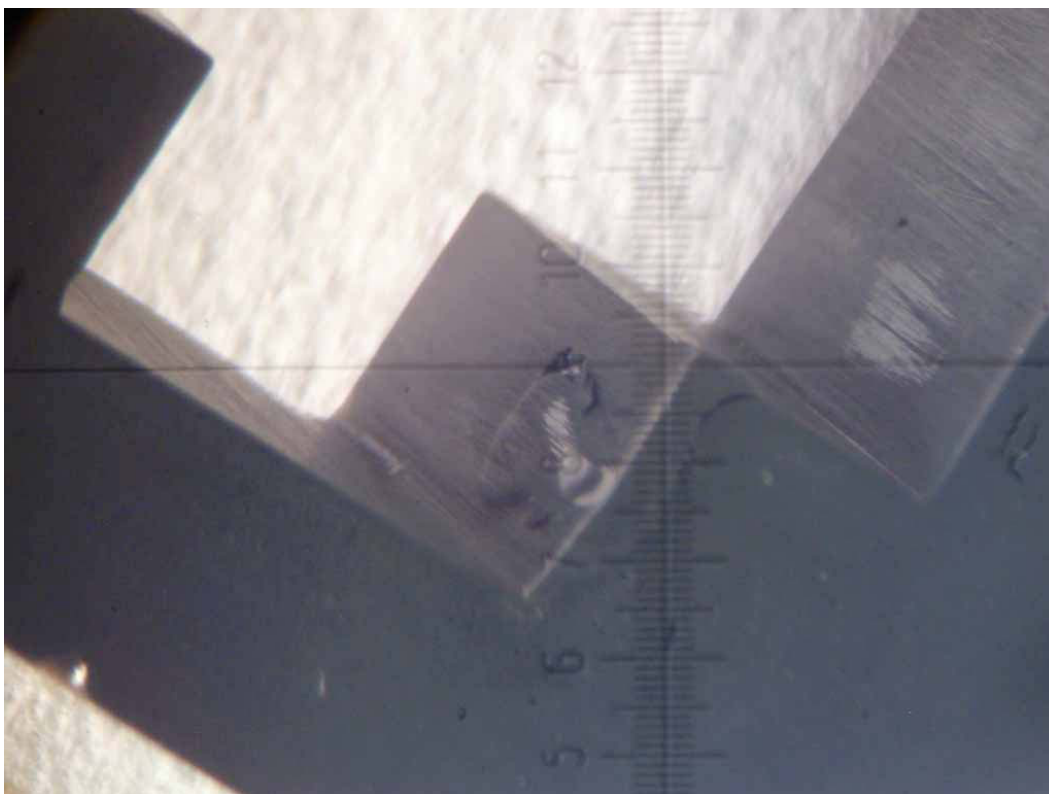






10.4 Specimen 3a – Cross@30GHz acetone

DATE	TIME	TEST CONDITION	NOTE
09/03/05	11.00	21.4°C40%HR	Visual Inspection: There is a defect on the external edge Mass: 17.9[g]
09/03/05	11.30		The specimen is covered with acetone
09/03/05	14.10		Visual Inspection: there aren't additional visible defects Mass: 17.9[g]
09/03/05	16.40		Visual Inspection: There are visible some white spots.
10/03/05	10.15	21.3°C47%HR	Visual Inspection: There are visible several cracks on all the specimen. It is needed to disrupt the backer to extract the specimen from the backer, since its volumes has increased.

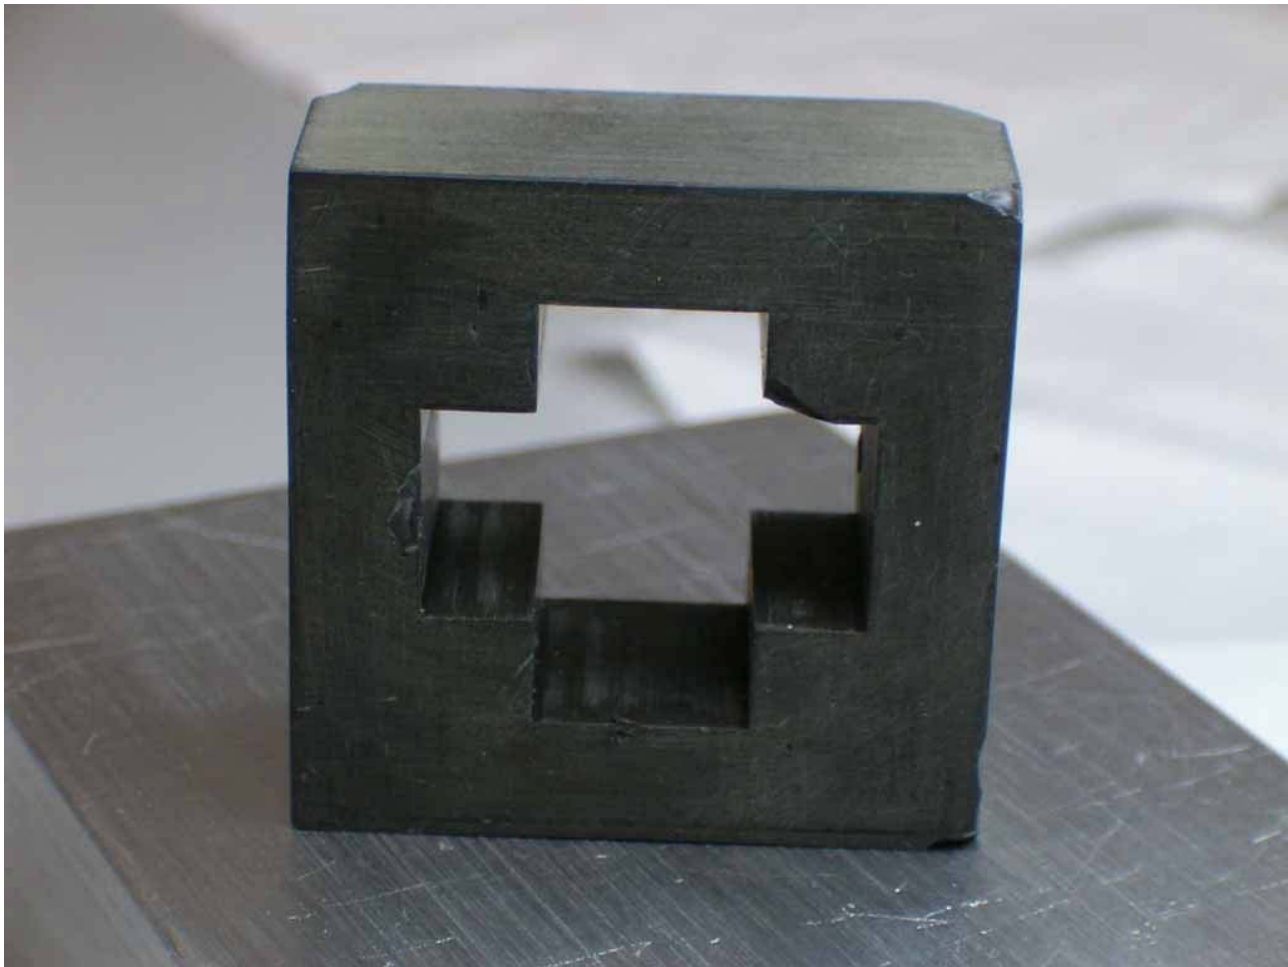







10.5 Specimen 3b – Cross@44GHz acetone

DATE	TIME	TEST CONDITION	NOTE
09/03/05	11.00	21.4°C40%HR	Visual Inspection: there aren't visible defects Mass: 5.6[g]
09/03/05	11.30		The specimen is covered with acetone
09/03/05	14.10		Visual Inspection: there aren't visible defects Mass: 5.6[g]
09/03/05	16.40		Visual Inspection: there aren't visible defects
10/03/05	10.15	21.3°C47%HR	Visual Inspection: There are visible several cracks on all the specimen. It is needed to disrupt the backer to extract the specimen from the backer.

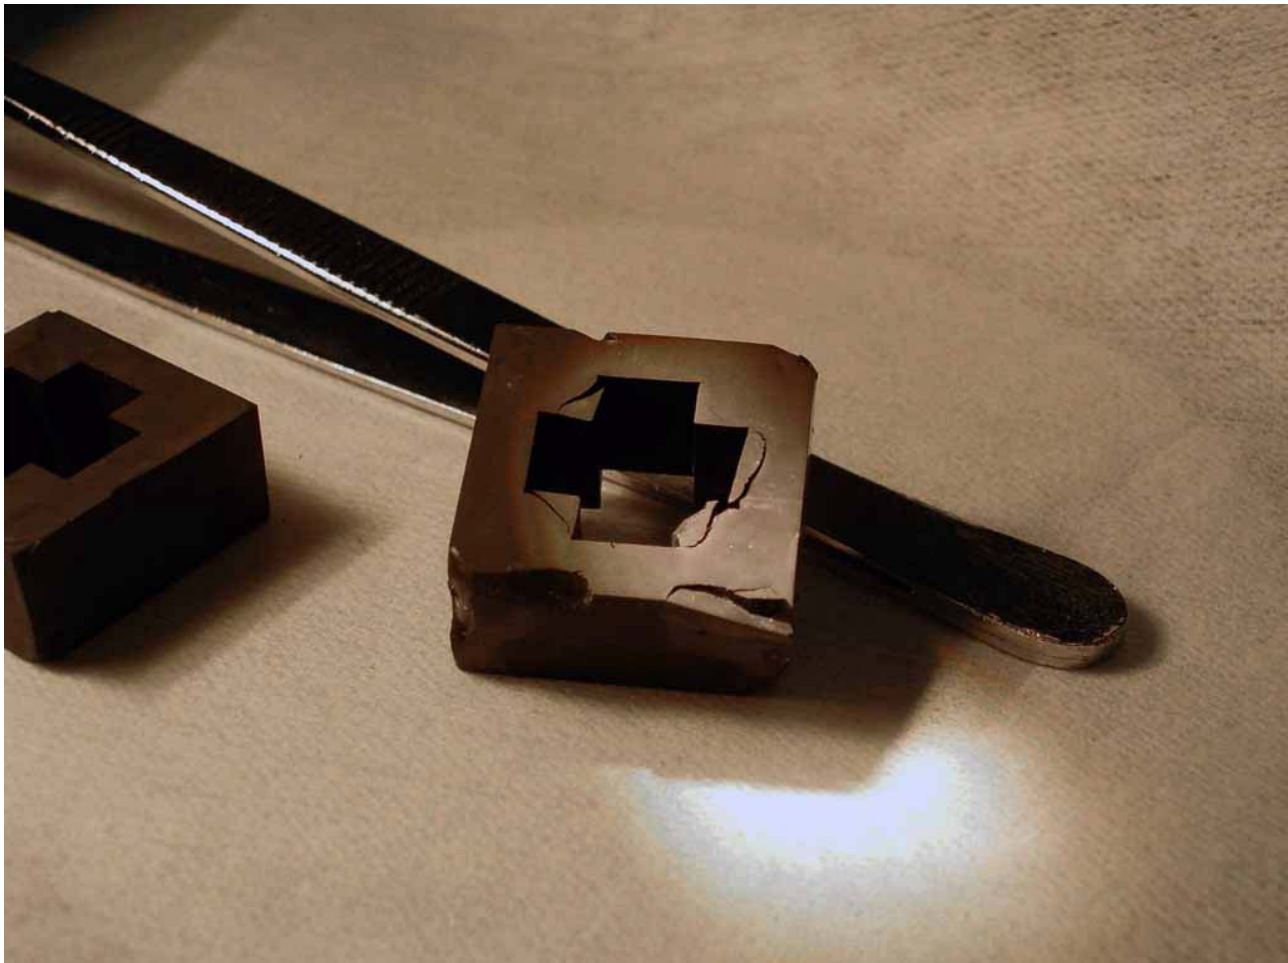


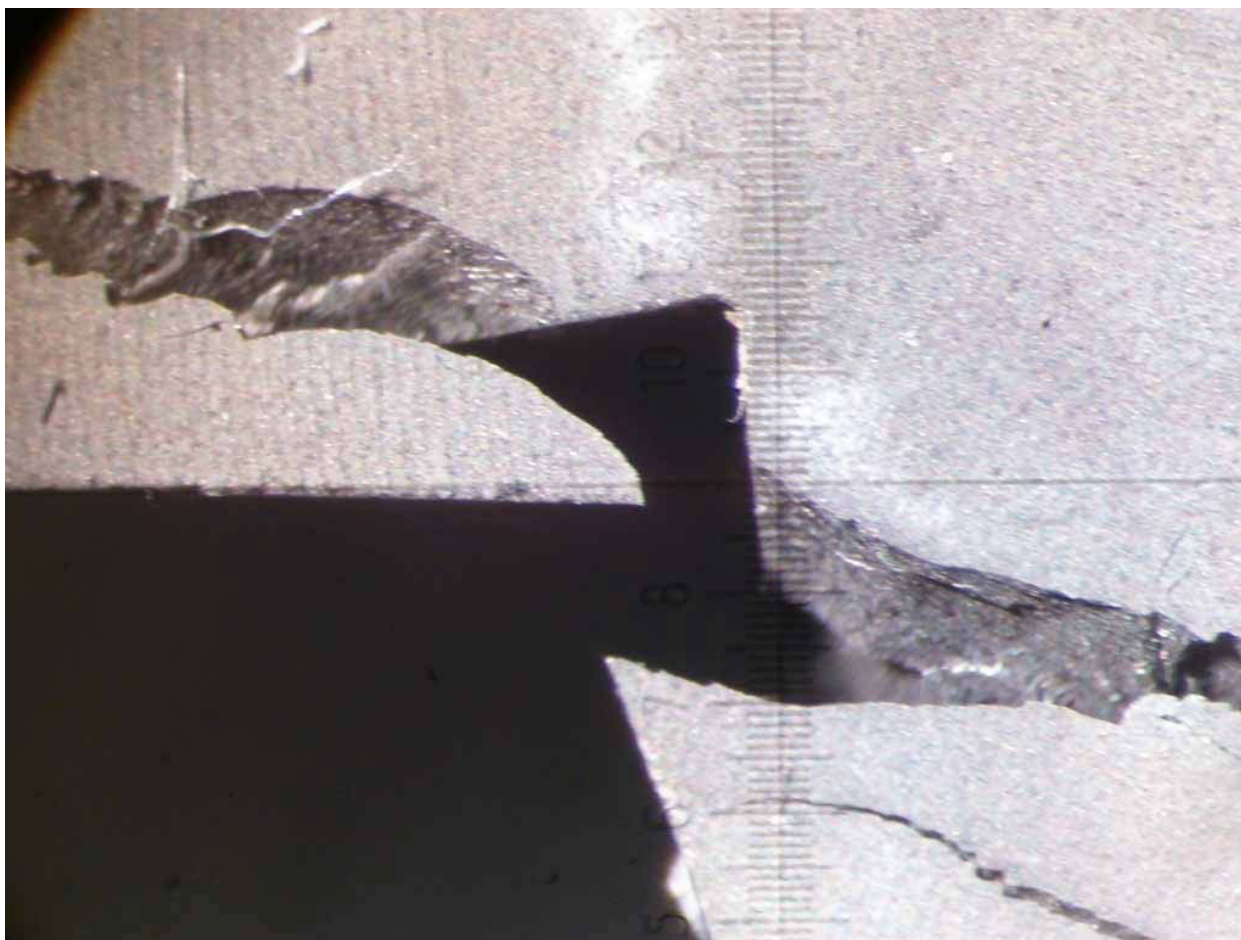



10.6 Specimen 4 – Sandwich Al6061-ECR110-ECR bonded acetone

DATE	TIME	TEST CONDITION	NOTE
09/03/05	11.00	21.4°C40%HR	Visual Inspection: There aren't visible defects. Mass: 1.9[g]
09/03/05	11.30		The specimen is covered with acetone
09/03/05	14.10		Visual Inspection: there aren't visible defects Mass: 1.9[g]
09/03/05	16.40		Visual Inspection: there aren't visible defects
10/03/05	10.15	21.3°C47%HR	Visual Inspection: There aren't visible defects on the ECR, but the glueing is broken with a light hand force.

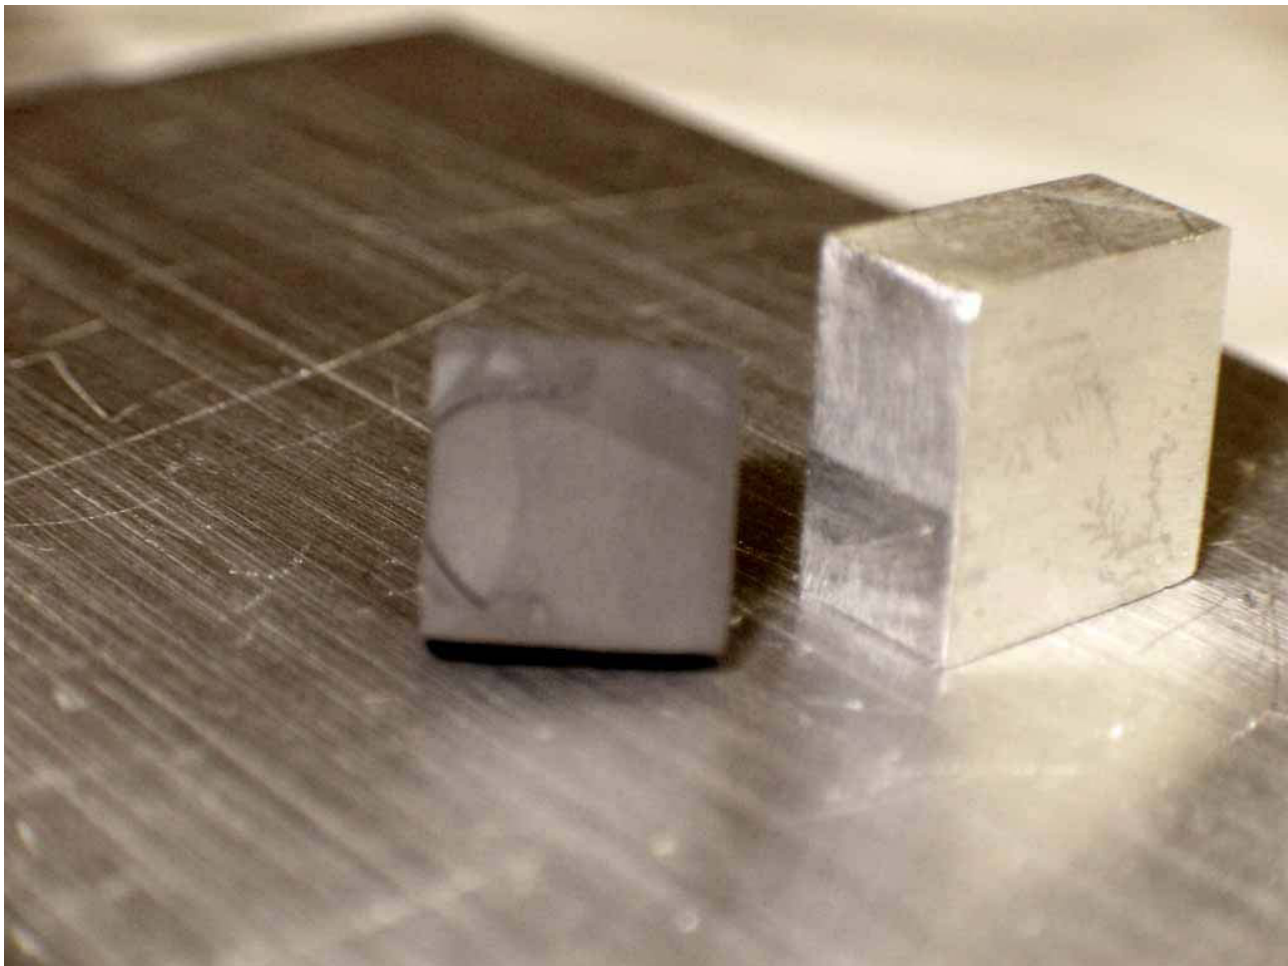

**10.7 Specimen 5a – Base@44GHz acetone&ultrasound**

DATE	TIME	TEST CONDITION	NOTE
09/03/05	11.00	21.4°C40%HR	Visual Inspection: There are visible several blister on 2 edges. Mass: 9.9 [g]
09/03/05	11.20		Start a battery of 3 cycles of ultrasonic cleaning bath
09/03/05	12.30		End of the cycles. Visual Inspection: The specimen doesn't have any crack. Mass: 9.9[g]
09/03/05	17.30	21.6°C40%HR	Start the IV cycle of ultrasonic cleaning bath
09/03/05	17.00		End of the cycle Visual Inspection: There aren't visible cracks on the edges
09/03/05	17.20		Start the V cycle of ultrasonic cleaning bath
09/03/05	17.45		End of the V cycle Visual Inspection: there aren't additional visible defects
10/03/05	16.00	21.3°C47%HR	Start of the VI cycle of ultrasonic cleaning bath
10/03/05	16.25		End of the VI cycle Visual Inspection: there aren't additional visible defects.
10/03/05	16.30		Start of the VII cycle of ultrasonic cleaning bath
10/03/05	16.55		End of the VII cycle of ultrasonic cleaning bath Visual inspection: there aren't additional visible defects.
11/03/05	11.15	21.6°C40%HR	Start of the VIII cycle of ultrasonic cleaning bath
11/03/05	11.40		End of the VIII cycle of ultrasonic cleaning bath Visual inspection: there aren't additional visible defects.
11/03/05	12.05		Start of the IX cycle of ultrasonic cleaning bath
11/03/05	14.05		End of the IX cycle of ultrasonic cleaning bath Visual inspection: there aren't additional visible defects.
11/03/05	14.12		Start of the X cycle of ultrasonic cleaning bath
11/03/05	14.35		End of the X cycle of ultrasonic cleaning bath Visual inspection: there aren't additional visible defects.
11/03/05	14.35		Start of the XI cycle of ultrasonic cleaning bath
11/03/05	15.00		End of the XI cycle of ultrasonic cleaning bath Visual inspection: there aren't additional visible defects.
11/03/05	15.05		Start of the XII cycle of ultrasonic cleaning bath
11/03/05	15.25		End of the XII cycle of ultrasonic cleaning bath Visual inspection: there aren't additional visible defects.
11/03/05	15.30		Start of the XIII cycle of ultrasonic cleaning bath
11/03/05	15.55		End of the XIII cycle of ultrasonic cleaning bath Visual inspection: there aren't additional visible defects.




**10.8 Specimen 5b – Sandwich Al6061-ECR110-ECR bonded acetone&ultrasound**

DATE	TIME	TEST CONDITION	NOTE
09/03/05	11.00	21.4°C40%HR	Visual Inspection: There aren't visible defects Mass: 2.1[g]
09/03/05	11.20		Start a battery of 3 cycles of ultrasonic cleaning bath
09/03/05	12.30		End of the battery of test. Visual Inspection: The specimen doesn't have any crack. Mass: 2.1[g]
09/03/05	16.30	21.6°C40%HR	Start a cycle of ultrasonic cleaning bath
09/03/05	17.00		End of the cycle Visual Inspection: There aren't visible cracks on the edges
09/03/05	17.20		Start the V cycle of ultrasonic cleaning bath
09/03/05	17.45		End of the V cycle Visual Inspection: there aren't visible defects
10/03/05	16.00	21.3°C47%HR	Start of the VI cycle of ultrasonic cleaning bath
10/03/05	16.25		End of the VI cycle Visual Inspection: there aren't visible defects.
10/03/05	16.30		Start of the VII cycle of ultrasonic cleaning bath
10/03/05	16.55		End of the VII cycle of ultrasonic cleaning bath Visual inspection: there aren't visible defects.
11/03/05	11.15	21.6°C40%HR	Start of the VIII cycle of ultrasonic cleaning bath
11/03/05	11.40		End of the VIII cycle of ultrasonic cleaning bath Visual inspection: there aren't visible defects.
11/03/05	12.05		Start of the IX cycle of ultrasonic cleaning bath
11/03/05	14.05		End of the IX cycle of ultrasonic cleaning bath Visual inspection: there aren't visible defects.
11/03/05	14.12		Start of the X cycle of ultrasonic cleaning bath
11/03/05	14.35		End of the X cycle of ultrasonic cleaning bath Visual inspection: there aren't visible defects.
11/03/05	14.35		Start of the XI cycle of ultrasonic cleaning bath
11/03/05	15.00		End of the XI cycle of ultrasonic cleaning bath Visual inspection: there aren't visible defects.
11/03/05	15.05		Start of the XII cycle of ultrasonic cleaning bath
11/03/05	15.25		End of the XII cycle of ultrasonic cleaning bath Visual inspection: there aren't visible defects.
11/03/05	15.30		Start of the XIII cycle of ultrasonic cleaning bath
11/03/05	15.55		End of the XIII cycle of ultrasonic cleaning bath Visual inspection: there aren't visible defects.




10.9 Specimen 6 – Cross@30GHz water&ultrasound

DATE	TIME	TEST CONDITION	NOTE
10/03/05	15.00	21.3°C47%HR	Visual Inspection: There is a long crack on one of the internal edges. Mass: 18.28 [g]
10/03/05	16.00		Start of the I cycle of ultrasonic cleaning bath
10/03/05	16.25		End of the cycle Visual Inspection: there aren't additional visible defects.
10/03/05	16.30		Start of the II cycle of ultrasonic cleaning bath
10/03/05	16.55		End of the II cycle Visual Inspection: there aren't additional visible defects.
11/03/05	11.15	21.6°C40%HR	Start of the III cycle of ultrasonic cleaning bath
11/03/05	11.40		End of the III cycle of ultrasonic cleaning bath Visual inspection: there aren't additional visible defects.
11/03/05	12.05		Start of the IV cycle of ultrasonic cleaning bath
11/03/05	14.05		End of the IV cycle of ultrasonic cleaning bath Visual inspection: there aren't additional visible defects.
11/03/05	14.12		Start of the V cycle of ultrasonic cleaning bath
11/03/05	14.35		End of the V cycle of ultrasonic cleaning bath Visual inspection: there aren't additional visible defects.
11/03/05	14.35		Start of the VI cycle of ultrasonic cleaning bath
11/03/05	15.00		End of the VI cycle of ultrasonic cleaning bath Visual inspection: there aren't additional visible defects.
11/03/05	15.05		Start of the VII cycle of ultrasonic cleaning bath
11/03/05	15.25		End of the VII cycle of ultrasonic cleaning bath Visual inspection: there aren't additional visible defects.
11/03/05	15.30		Start of the VIII cycle of ultrasonic cleaning bath
11/03/05	15.55		End of the VIII cycle of ultrasonic cleaning bath Visual inspection: there aren't additional visible defects.

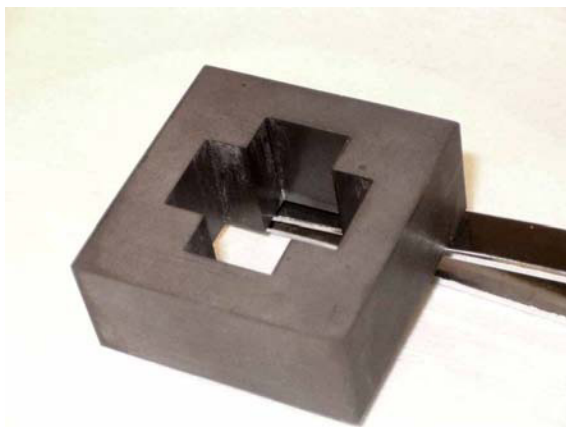

**10.10 Specimen 7 – base@44GHz acetone**

DATE	TIME	TEST CONDITION	NOTE
09/03/05	11.00	21.4°C40%HR	Visual Inspection: There aren't visible defects Mass: 9.3[g]
09/03/05	11.30		The specimen is covered with acetone
09/03/05	14.10		Visual Inspection: there aren't visible defects Mass: 9.3[g]
09/03/05	16.40		Visual Inspection: there aren't visible defects
10/03/05	10.15	21.3°C47%HR	Visual Inspection: There aren't visible defects. Mass: 9.7[g]
10/03/05	16.50		Visual Inspection: there aren't visible defects
11/03/05	11.00		Visual Inspection: there aren't visible defects Mass: 9.79 [g]
11/03/05	14.12		Visual Inspection: there aren't visible defects
11/03/05	16.00		Visual Inspection: there aren't visible defects
14/03/05	9.50		Visual Inspection: the acetone is evaporated and there is a viscous liquid on the surface and it is easy to scratch. Mass: 9.83 [g]
14/03/05	15.20		Visual Inspection: there aren't visible defects
15/03/05	10.00	21.5°C40.3%HR	Visual Inspection: there aren't visible defects, but it is possible to crack it with a light hand pressure. Mass: 9.92 [g]
15/03/05	15.30		Mass: 9.88 [g]

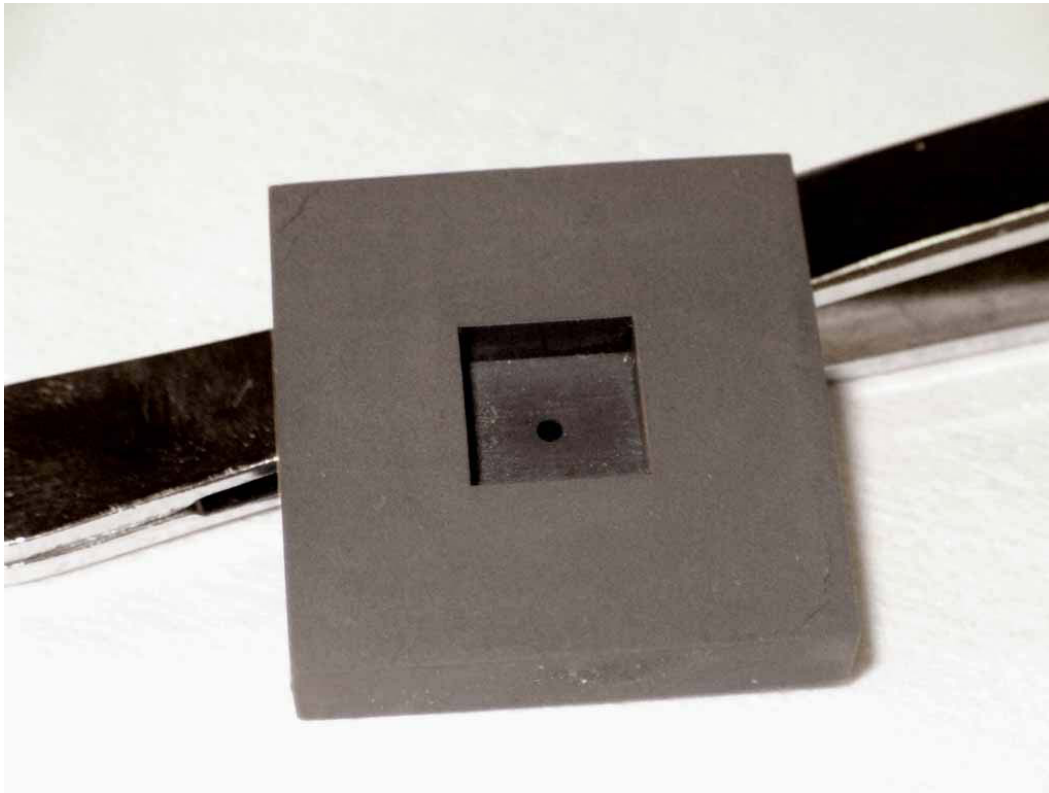




10.11 Specimen 8 – base@30GHz acetone

DATE	TIME	TEST CONDITION	NOTE
09/03/05	11.00	21.4°C40%HR	Visual Inspection: There aren't visible defects Mass: 21.0[g]
09/03/05	11.30		The specimen is covered with acetone
09/03/05	14.10		Visual Inspection: there aren't visible defects Mass: 21.0[g]
09/03/05	16.40		Visual Inspection: there aren't visible defects
10/03/05	10.15	21.3°C47%HR	Visual Inspection: There aren't visible defects, but with a light hand pressure it is possible to crack the more thin part of the specimen. Mass: 20.9[g]




10.12 Specimen 9 – bulk toluene

DATE	TIME	TEST CONDITION	NOTE
15/03/05	15.30	22.9°C38.7HR	Visual Inspection: the specimen has the lateral surfaces lumpy The specimen is partially covered with toluene
16/03/05	9.55		Visual Inspection: there is a log crack.

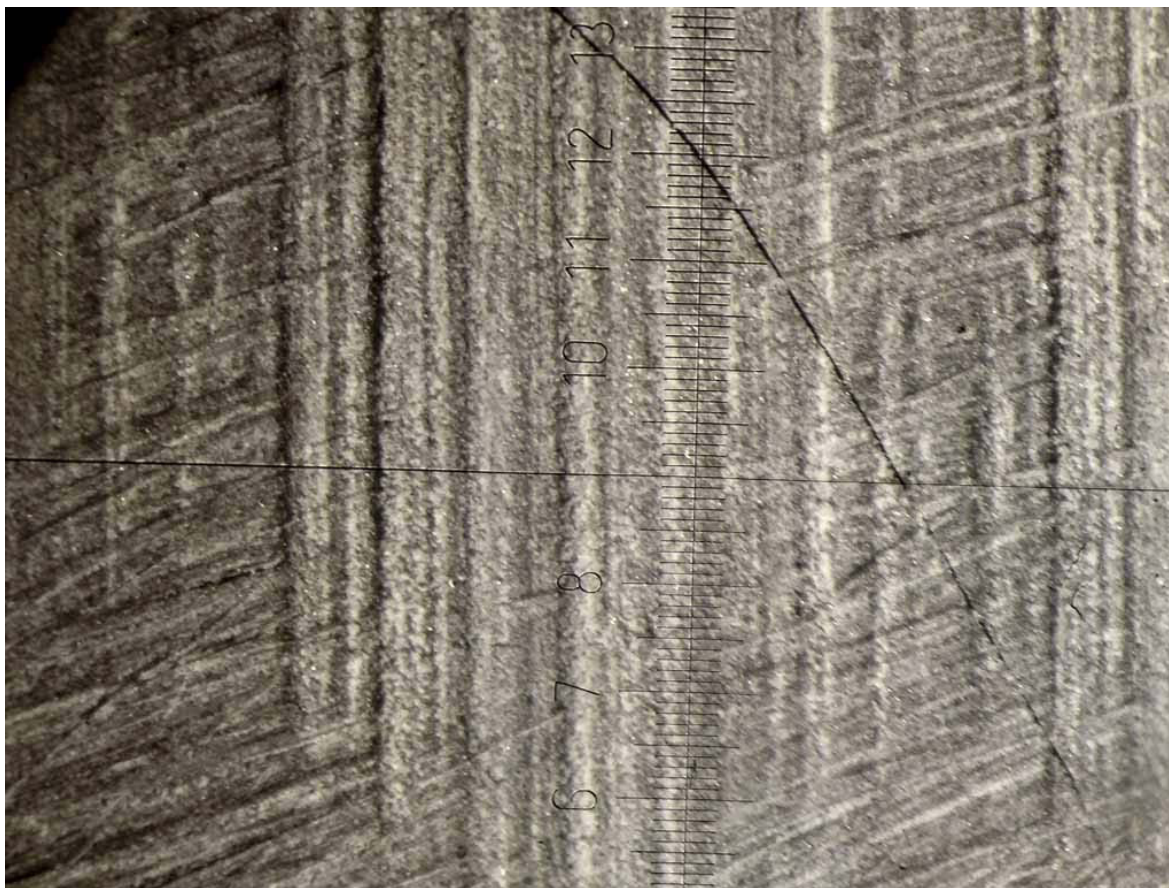



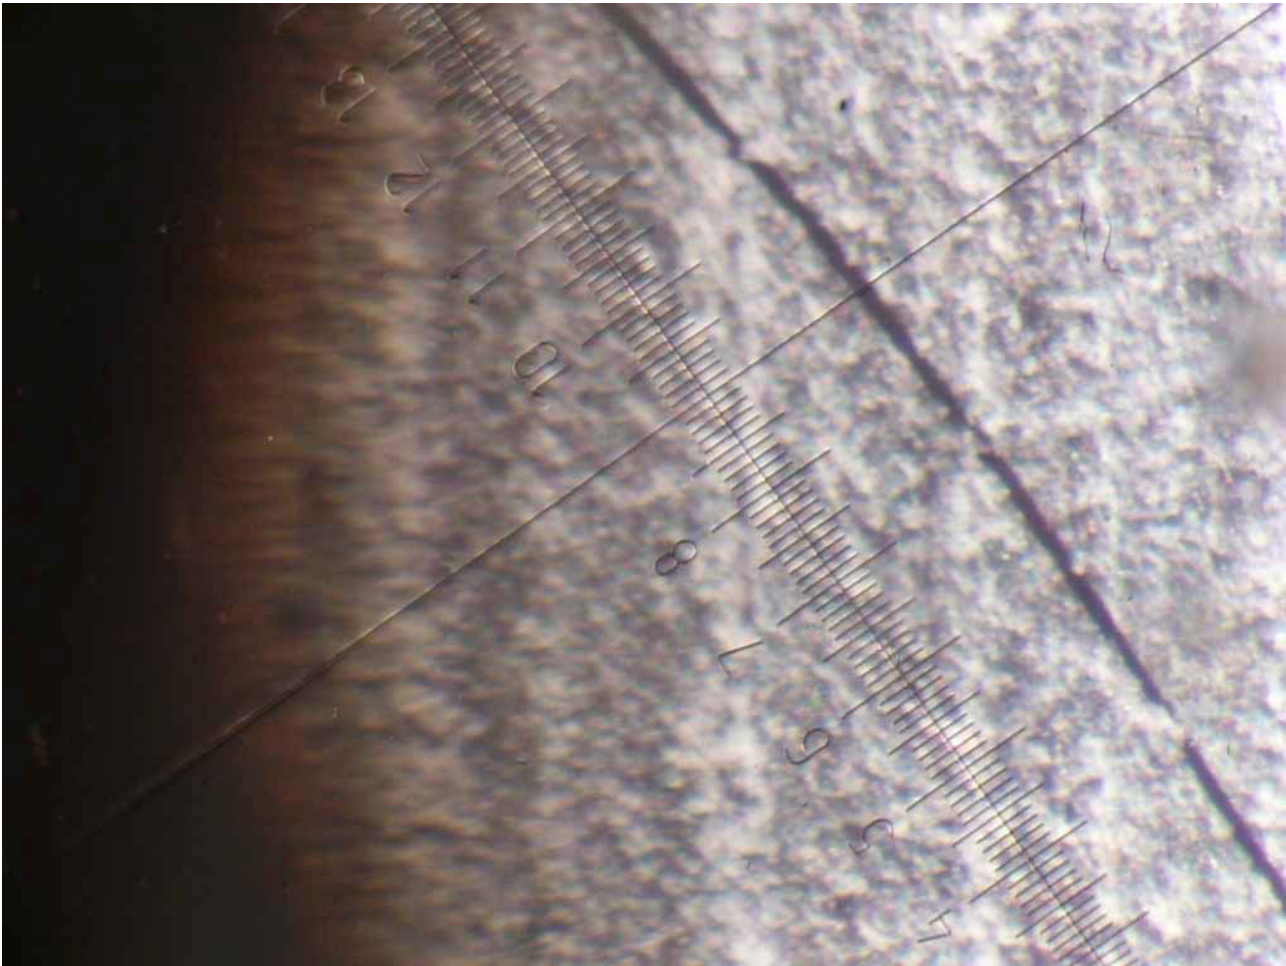



10.13 Specimen 10 – Pyramid acetone

DATE	TIME	TEST CONDITION	NOTE
09/03/05	11.00	21.4°C40%HR	Visual Inspection: There aren't visible defects Mass: 1.9[g]
09/03/05	11.30		The specimen is covered with acetone
09/03/05	14.10		Visual Inspection: there aren't visible defects Mass: 1.9[g]
09/03/05	16.40		Visual Inspection: there aren't visible defects
10/03/05	10.15	21.3°C47%HR	Visual Inspection: There aren't visible defects
10/03/05	16.50		Visual Inspection: there aren't visible defects
11/03/05	11.00		Visual Inspection: there aren't visible defects Mass: 1.94 [g]
11/03/05	14.12		Visual Inspection: there aren't visible defects
11/03/05	16.00		Visual Inspection: there aren't visible defects
14/03/05	9.50		Visual Inspection: there aren't visible defects. The acetone is evaporated. Mass: 1.94 [g]
14/03/05	15.20		Visual Inspection: there aren't visible defects
15/03/05	10.00	21.5°C40.3%HR	Visual Inspection: there aren't visible defects. Mass: 1.95 [g]



**10.14 Specimen 11 – Plate water&ultrasound**

DATE	TIME	TEST CONDITION	NOTE
10/03/05	15.00	21.3°C47%HR	Visual Inspection: There aren't visible defects. Mass: [g]
10/03/05	16.00		Start of the I cycle of ultrasonic cleaning bath
10/03/05	16.25		End of the cycle Visual Inspection: there aren't visible defects.
10/03/05	16.30		Start of the II cycle of ultrasonic cleaning bath
10/03/05	16.55		End of the II cycle Visual Inspection: there aren't visible defects.
11/03/05	11.15	21.6°C40%HR	Start of the III cycle of ultrasonic cleaning bath
11/03/05	11.40		End of the III cycle of ultrasonic cleaning bath Visual inspection: there aren't visible defects.
11/03/05	12.05		Start of the IV cycle of ultrasonic cleaning bath
11/03/05	14.05		End of the IV cycle of ultrasonic cleaning bath Visual inspection: there aren't visible defects.
11/03/05	14.12		Start of the V cycle of ultrasonic cleaning bath
11/03/05	14.35		End of the V cycle of ultrasonic cleaning bath Visual inspection: there aren't visible defects.
11/03/05	14.35		Start of the VI cycle of ultrasonic cleaning bath
11/03/05	15.00		End of the VI cycle of ultrasonic cleaning bath Visual inspection: there aren't visible defects.
11/03/05	15.05		Start of the VII cycle of ultrasonic cleaning bath
11/03/05	15.25		End of the VII cycle of ultrasonic cleaning bath Visual inspection: there aren't visible defects.
11/03/05	15.30		Start of the VIII cycle of ultrasonic cleaning bath
11/03/05	15.55		End of the VIII cycle of ultrasonic cleaning bath Visual inspection: there aren't visible defects.



10.15 Specimen 12 – Bulk water

DATE	TIME	TEST CONDITION	NOTE
10/03/05	14.30	21.3°C47%HR	Visual Inspection: there aren't visible defects Mass: 53.71 [g]
10/03/05	16.50		Visual Inspection: there aren't visible defects
11/03/05	11.00		Visual Inspection: there aren't visible defects Mass:
11/03/05	14.12		Visual Inspection: there aren't visible defects
11/03/05	16.00		Visual Inspection: there aren't visible defects
14/03/05	9.50		Visual Inspection: there aren't visible defects Mass: 53.75 [g]
14/03/05	15.20		Visual Inspection: there aren't visible defects





10.16 Specimen 13 – Bulk GE glue reactivated

DATE	TIME	TEST CONDITION	NOTE
15/03/05	15.30		The specimen is partially covered with GE glue reactivated with toluene.
16/03/05	9.55		Visual Inspection: there aren't visible defects.
17/03/05	14.00		Visual Inspection: there aren't visible defects.
18/03/05	12.10		Visual Inspection: there aren't visible defects.
21/03/05	15.00		Visual Inspection: there aren't visible defects.



